Hauppauge Union Free School District

Districtwide Lead in Drinking Water Sampling and Remediation Plan

2020



2150 Smithtown Avenue Ronkonkoma, NY 11779 (631) 580-3191 www.envirohealth.org

Project #19443

<u>Districtwide Lead in Drinking Water</u> <u>Sampling and Remediation Plan</u>

Performed for:

Hauppauge Union Free School District 495 Hoffman Lane Hauppauge, NY 11788

June 2020

Prepared by:

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779 (631) 580-3191

Grenn Huschel

Project #19443

President

Glenn Neuschwender



Districtwide Lead in Drinking Water Sampling and Remediation Plan

Table of Contents

l.	Executive	Summary
----	-----------	---------

- **II. Sampling Methodology**
- **III. Initial Results**

Appendix A – Bretton Woods Elementary School

Appendix B – Forest Brook Elementary School

Appendix C – Pines Elementary School

Appendix D – Whiporwil Elementary School

Appendix E- Hauppauge Middle School

Appendix F – Hauppauge High School





July 17, 2020

Ernesto Rosini Hauppauge Union Free School District 495 Hoffman Lane Hauppauge, NY 11788

I. Executive Summary

Hauppauge Union Free School District has developed their 2020 Lead in Drinking Water Sampling and Analysis Program, as required by the New York State Department of Health (Public Health Law Sections 1370-a and 1110, Subpart 67-4 Lead Testing in School Drinking Water).

In accordance with the regulation, this Lead Remediation Plan is prepared to identify locations deemed as Applicable Drinking Water Sources and report first draw sample results, to mitigate locations where sample results exceed 15 parts per billion, to identify locations deemed as Non-Applicable Water Sources, communicate this designation to building occupants, and to develop strategies for monitoring locations deemed Non-Applicable Water Sources to insure building occupants do not consume water from these locations.

The following locations within the Hauppauge UFSD buildings have been deemed Applicable Drinking Water Sources by the administration:

- 1) Water fountains and bottle filling stations;
- 2) Kitchen water faucets and pot fillers used in food preparation;
- 3) Ice machines
- 4) Elementary classroom bathroom sinks
- 5) Home Economics and Cooking Career focused classroom sinks
- 6) Nurse's Office and Faculty Room sinks

First draw samples were collected from each of these locations within the District, and analyzed by a New York State Department of Health ELAP certified laboratory. The chains of custody are available upon request. For results at or below 15 ppb, no further action is required until 2025. For locations above 15 ppb, options include: second and third draw sample collection to determine source of lead, designation of the location as Non-applicable Water Source, or permanent removal of the fixture from the location. In either case, the result was communicated by Enviroscience Consultants, and the fixture was shut off by the District immediately upon receipt of results.

The following locations within the Hauppauge UFSD buildings were deemed Non-Applicable Water Sources by the administration:



- 1) Science Laboratory sinks
- 2) Art Room sinks
- 3) Technical Classroom sinks
- 4) Other Bathroom sinks
- 5) Outside spigots
- 6) Custodial Closet sinks

In these cases, the Hauppauge facilities staff have placed signs adjacent to the fixture to notify occupants that the water is not intended for consumption. To further support this protocol, the following management of the locations is required:

- 1) Science Laboratory sinks communicate in writing with students that these locations are for science experiments and hand washing only, not for consumption. This is most easily accomplished by including this language in the laboratory safety paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective science teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 2) Art Room sinks communicate in writing to students that these locations are for cleaning of art supplies and hand washing only, not for consumption. This is most easily accomplished by including this language in the course paperwork distributed to students at the beginning of the school year. This program should be monitored by the respective art teachers, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 3) Other classroom sinks classrooms in this category often include elementary classrooms, where students are to hand wash after bathroom usage or activities as part of a regular hygiene program. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 4) Other bathroom sinks in intermediate buildings, signage should be sufficient for communicating the concept of hand washing only. In elementary schools, personal hygiene should be integrated into curriculum to ensure students understand bathroom sinks are for hand washing only, and not consumption. Further, show what the signage looks like in bathrooms so they learn to recognize its meaning. This program should be monitored by teachers and staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 5) Outside spigots all-weather signage will be installed at each location. Further, spigots will have a special key maintained by the custodial staff to ensure that non-authorized persons do not fill sports coolers or use hoses for consumption. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.
- 6) Custodial Closet sinks these locations should be accessed by custodial personnel only, and locked when not in use. Access to others should be restricted. This program should be monitored by custodial staff to ensure consumption is not taking place, and any deficiencies reported for assessment and revision, if necessary, by the Facilities Department.



II. Sampling Methodology

In accordance with the regulation, Enviroscience Consultants, Inc. performed initial water sampling throughout the Hauppauge UFSD buildings from June 25-June 30, 2020. Samples were collected in wide-mouth 250 milliliter containers and were collected in the morning hours before the facilities opened. The water sources were not used for at least 8 hours and not more that 18 hours prior to sampling. Unique source numbers and designations were assigned to each source location. Unique sample identification numbers were assigned to each sample taken. The key to fixture type codes and the sampling location schematics are shown below.

Fixture Type Codes

BF Bottle Filler

HB Hose Bib

IM Ice Machine

OS Other Source

PF Pot Filler

SK Sink

SL Supply Line

SP Spigot

SPY Spray

SS Slop Sink

V Valve

WC Water Cooler

WF Water Fountain


Source Designations

App Applicable

N/A Non-applicable



Sampling Location Schematics

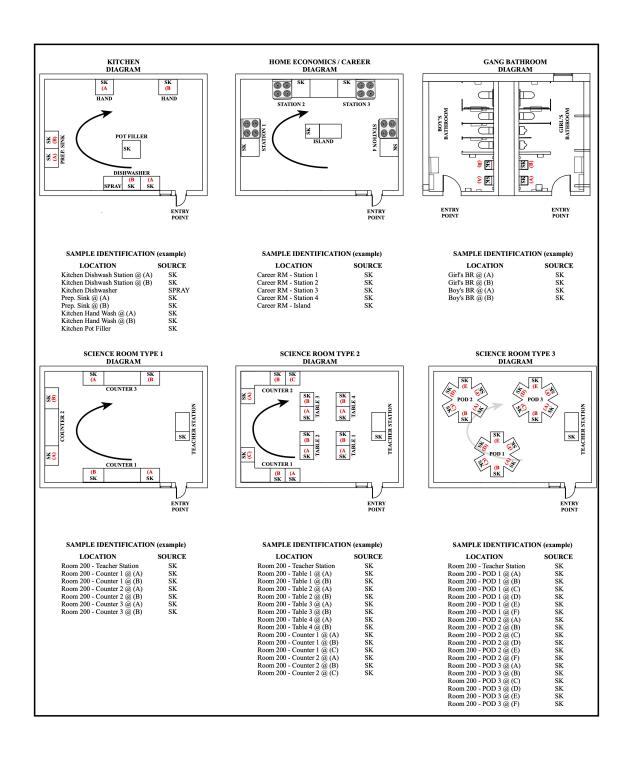



III. Initial Results:

All water source locations in each of the school buildings were assessed. Water source locations identified as drinking water sources were considered Applicable, and first draw samples were collected. Water source locations identified as non-drinking water sources were considered Non-applicable and these locations were documented.

The results of the initial sampling and the use of signs warning against water use at Non-applicable sources is documented in the School Water Outlet Inventory for each building (Appendix A through F).

All elevated locations should be taken off line until the remediation is completed. Any other drinking water sources in these buildings that were not functional at the time of initial sampling and have not been tested should be tested. All locations deemed non-applicable, but do not have signs, should be taken off line until signs have been posted.

The following is a summary of results in parts per billion (ppb) of locations where sample results were found above 15 ppb:



Bretton Woods Elementary School

Kitchen Pot Filler SK 507 Kitchen 3 Bay (Left) SK 71.7 Kitchen 3 Bay (Right) SK 33.5 Kitchen 2 Bay (Left) SK 15.2 Book Room 1-1 Bathroom SK 25.7 Room 1-3 Bathroom SK 19.9 Room 1-5 Bathroom SK 44.6 Room 1-6 Bathroom SK 16.6 Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 27.7 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17 Room 4-12 WF 21.9			
Kitchen 3 Bay (Right) SK 33.5 Kitchen 2 Bay (Left) SK 15.2 Book Room 1-1 Bathroom SK 25.7 Room 1-3 Bathroom SK 19.9 Room 1-5 Bathroom SK 44.6 Room 1-6 Bathroom SK 16.6 Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Kitchen Pot Filler	SK	507
Kitchen 2 Bay (Left) SK 15.2 Book Room 1-1 Bathroom SK 25.7 Room 1-3 Bathroom SK 19.9 Room 1-5 Bathroom SK 44.6 Room 1-6 Bathroom SK 16.6 Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 27.7 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Kitchen 3 Bay (Left)	SK	71.7
Book Room 1-1 Bathroom SK 25.7 Room 1-3 Bathroom SK 19.9 Room 1-5 Bathroom SK 44.6 Room 1-6 Bathroom SK 16.6 Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 27.7 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Kitchen 3 Bay (Right)	SK	33.5
Room 1-3 Bathroom SK 19.9 Room 1-5 Bathroom SK 44.6 Room 1-6 Bathroom SK 16.6 Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Kitchen 2 Bay (Left)	SK	15.2
Room 1-5 Bathroom SK 44.6 Room 1-6 Bathroom SK 16.6 Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Book Room 1-1 Bathroom	SK	25.7
Room 1-6 Bathroom SK 16.6 Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-8 Bathroom SK 21.3 Room 1-11 Bathroom SK 25.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 1-3 Bathroom	SK	19.9
Room 1-7 Bathroom SK 19.2 Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 1-5 Bathroom	SK	44.6
Room 1-8 WF 102 Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 1-6 Bathroom	SK	16.6
Room 1-8 Bathroom SK 27.9 Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 1-7 Bathroom	SK	19.2
Room 1-11 Bathroom SK 21.3 Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 1-8	WF	102
Room 2-2 Bathroom SK 25.3 Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 1-8 Bathroom	SK	27.9
Room 2-3 WF 18.8 Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 1-11 Bathroom	SK	21.3
Room 2-6 Bathroom SK 16.3 Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 2-2 Bathroom	SK	25.3
Room 2-7 Bathroom SK 27.7 Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 2-3	WF	18.8
Room 2-9 WF 142 Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 2-6 Bathroom	SK	16.3
Room 2-9 Bathroom SK 109 Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 2-7 Bathroom	SK	27.7
Boys Locker Room Bathroom Back Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 2-9	WF	142
Vestibule WF 23.6 Room 4-2 WF 24 Room 4-8 WF 16.1 Room 4-10 WF 17	Room 2-9 Bathroom	SK	109
Room 4-8 WF 16.1 Room 4-10 WF 17		WF	23.6
Room 4-10 WF 17	Room 4-2	WF	24
	Room 4-8	WF	16.1
Room 4-12 WF 21.9	Room 4-10	WF	17
	Room 4-12	WF	21.9



Forest Brook Elementary School

Room 308	WF	16.8
Room 311 Bathroom	SK	38.9
Room 303	WF	28.7
Room 202	WF	20
Room 204 Bathroom	SK	24.1
Room 206 Bathroom	SK	23.1
Room 208 Bathroom	SK	21.4
Room 210 Bathroom	SK	21.2
Room 209 Bathroom	SK	31.6
Room 106 Bathroom	SK	41.5
Room 110 Bathroom	SK	31.8
Room 109 Bathroom	SK	36.2
Room 105 Bathroom	SK	19.2
Room 101 Bathroom	SK	26
Faculty Room	SPY	16.7
Room 412	WF	23.3
Room 403	WF	19.7

Pines Elementary School

Room S-5 Bathroom	SK	24.2
Room M-11	WF	23.1
Room M-14 Bathroom	SK	40.8
Nurses Office Exam Room	SK	18.2
Room M-3	WF	16
Room 208	WF	21



Whiporwil Elementary School

Accounts Payable	SPY	99.2
Pupil Personnel Services Kitchenette	SK	58.4
Conference Room	SK	22.6
Buildings & Grounds Kitchenette	SK	19.2
Transportation Bathroom/Kitchenette	SK	38.8
Room 40	SK	19.5
Room 42	SK	17.8
Room 48	SK	42.3
Room 43	WF	21.8
Room 32	SK	72.9
Room 32	SPY	30.4

Hauppauge Middle School

Kitchen Pot Filler @ A (Left)	SP	109
Auxilary Gym	WF	15.9
Tech Room M-11 @ C (Right)	SK	82.4
Nurses Office by Main Desk	SK	33.7
Library Break Room	SK	20.9
Home Ec Room C-23 Station 2	SK	15.2
Home Ec Room C-23 Station 3	SK	20.7
Home Ec Room C-23 Station 4	SK	64.4
Home Ec Room C-22 Station 1	SK	16.2
Home Ec Room C-22 Station 4	SK	19.1



Hauppauge High School

Photo Copy Room 144A	SK	20
Eagles Nest Kitchen by Security 2 Bay	SK	34.1
Main Office Nurses Office	WF	40.7
Home Economics Room 232A	SK	18
Home Economics Room 232	SS	30.1
Concession Stand	SK	99.2
Library Office	SK	23
Science Room 345 Prep Room	SK	26.8
Career Center Room 351 Kitchenette	SK	25.1

Appendix A



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen 1 Bay by Walk-in Freezer	SK	Арр	7.38	6/26/2020	-	-	-	None	-	-	-
1001-2	Kitchen Pot Filler	SK	Арр	507	6/26/2020				Additional Sampling Required			
1001-3	Kitchen 3 Bay (Left)	SK	Арр	71.7	6/26/2020				Additional Sampling Required			
1001-4	Kitchen 3 Bay (Right)	SK	Арр	33.5	6/26/2020				Additional Sampling Required			
1001-5	Kitchen 2 Bay (Left)	SK	Арр	15.2	6/26/2020				Additional Sampling Required			
1001-6	Kitchen 2 Bay (Right-Handwash)	SK	N/A		6/26/2020	-	-	-	None	SIGN	-	-
1001-7	Kitchen Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1002-1	Hall by Café	WF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1002-2	Hall by Café	BF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1003-1	Custodial Closet by Café	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1004-1	Book Room 1-1	WF	Арр	3.32	6/26/2020	-	-	-	None	-	-	-
1004-2	Book Room 1-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1004-3	Book Room 1-1 Bathroom	SK	Арр	25.7	6/26/2020				Additional Sampling Required			
1005-1	Room 1-2	WF	Арр	4.66	6/26/2020	-	-	-	None	-	-	-
1005-2	Room 1-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1005-3	Room 1-2 Bathroom	SK	Арр	2.5	6/26/2020	-	-	-	None	-	-	-
1006-1	Room 1-3	WF	Арр	2.08	6/26/2020	-	-	-	None	-	-	-
1006-2	Room 1-3	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1006-3	Room 1-3 Bathroom	SK	Арр	19.9	6/26/2020				Additional Sampling Required			
1007-1	Room 1-4	WF	Арр	10.2	6/26/2020	-	-	-	None	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-2	Room 1-4	SK	N/A	2.48	6/26/2020	-	-	-	Sign Required	-	-	-
1007-3	Room 1-4 Bathoom	SK	Арр	2.48	6/26/2020	-	-	-	None	-	-	-
1008-1	Room 1-5	WF	Арр	8.19	6/26/2020	-	-	-	None	-	-	-
1008-2	Room 1-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1008-3	Room 1-5 Bathroom	SK	Арр	44.6	6/26/2020				Additional Sampling Required			
1009-1	Room 1-6	WF	Арр	3.37	6/26/2020	-	-	-	None	-	-	-
1009-2	Room 1-6	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1009-3	Room 1-6 Bathroom	SK	Арр	16.6	6/26/2020				Additional Sampling Required			
1010-1	Room 1-7	WF	Арр	3.56	6/26/2020	-	-	-	None	-	-	-
1010-2	Room 1-7	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1010-3	Room 1-7 Bathroom	SK	Арр	19.2	6/26/2020				Additional Sampling Required			
1011-1	Room 1-8	WF	Арр	102	6/26/2020				Additional Sampling Required			
1011-2	Room 1-8	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1011-3	Room 1-8 Bathroom	SK	Арр	27.9	6/26/2020				Additional Sampling Required			
1012-1	Room 1-9	WF	Арр	1.79	6/26/2020	-	-	-	None	-	-	-
1012-2	Room 1-9	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1012-3	Room 1-9 Bathroom	SK	Арр	12	6/26/2020	-	-	-	None	-	-	-
1013-1	Art Room 1-10	WF	Арр	2.7	6/26/2020	-	-	-	None	-	-	-
1013-2	Art Room 1-10	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1013-3	Art Room 1-10 Brush Wash	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-4	Art Room 1-10 Bathroom	SK	Арр	10.1	6/26/2020	-	-	-	None	-	-	-
1014-1	Room 1-11	WF	Арр	3.85	6/26/2020	-	-	-	None	-	-	-
1014-2	Room 1-11	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1014-3	Room 1-11 Bathroom	SK	Арр	21.3	6/26/2020				Additional Sampling Required			
1015-1	Room 2-1	WF	Арр	5.34	6/26/2020	-	-	-	None	-	-	-
1015-2	Room 2-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1015-3	Room 2-1 Bathroom	SK	Арр	10.5	6/26/2020	-	-	-	None	-	-	-
1016-1	Room 2-2	WF	Арр	1.51	6/26/2020	-	-	-	None	-	-	-
1016-2	Room 2-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1016-3	Room 2-2 Bathroom	SK	Арр	25.3	6/26/2020				Additional Sampling Required			
1017-1	Room 2-3	WF	Арр	18.8	6/26/2020				Additional Sampling Required			
1017-2	Room 2-3	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1017-3	Room 2-3 Bathroom	SK	Арр	8.88	6/26/2020	-	-	-	None	-	-	-
1018-1	Room 2-4	WF	Арр	1.72	6/26/2020	-	-	-	None	-	-	-
1018-2	Room 2-4	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1018-3	Room 2-4 Bathroom	SK	Арр	14.9	6/26/2020	-	-	-	None	-	-	-
1019-1	Room 2-5	WF	Арр	7.44	6/26/2020	-	-	-	None	-	-	-
1019-2	Room 2-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1019-3	Room 2-5 Bathroom	SK	Арр	1.94	6/26/2020	-	-	-	None	-	-	-
1020-1	Room 2-6	WF	Арр	1.16	6/26/2020	-	-	-	None	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-2	Room 2-6	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1020-3	Room 2-6 Bathroom	SK	Арр	16.3	6/26/2020				Additional Sampling Required			
1021-1	Room 2-7	WF	Арр	2.11	6/26/2020	-	-	-	None	-	-	-
1021-2	Room 2-7	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1021-3	Room 2-7 Bathroom	SK	Арр	27.7	6/26/2020				Additional Sampling Required			
1022-1	Room 2-8	WF	Арр	6.49	6/26/2020	-	-	1	None	1	-	i
1022-2	Room 2-8	SK	N/A		6/26/2020	-	-	-	Sign Required	1	-	ı
1022-3	Room 2-8 Bathroom	SK	Арр	13.9	6/26/2020	-	-	-	None	-	-	-
1023-1	Room 2-9	WF	Арр	142	6/26/2020				Additional Sampling Required			
1023-2	Room 2-9	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1023-3	Room 2-9 Bathroom	SK	Арр	109	6/26/2020				Additional Sampling Required			
1024-1	Room 2-10	WF	Арр	8.54	6/26/2020	-	-	-	None	-	-	-
1024-2	Room 2-10	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1025-1	Girls Bathroom by Room 2-10 @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1025-2	Girls Bathroom by Room 2-10 @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1025-3	Girls Bathroom by Room 2-10 @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1026-1	Boys Bathroom by Room 2-10 @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1026-2	Boys Bathroom by Room 2-10 @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1026-3	Boys Bathroom by Room 2-10 @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1027-1	Custodial Closet by Room 2-10	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-1	Room 2-12	WF	Арр	5.73	6/26/2020	-	-	-	None	-	-	-
1028-2	Room 2-12	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1029-1	Hall by Room 2-14	WF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1030-1	ESL Room 2-14	WF	Арр	6.27	6/26/2020	-	-	-	None	-	-	-
1030-2	ESL Room 2-14	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1031-1	Science Lab Room 2-16	WF	Арр	7.26	6/26/2020	-	-	-	None	-	-	-
1031-2	Science Lab Room 2-16	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1032-1	Orchestra Room 2-18	WF	Арр	6.42	6/26/2020	-	-	-	None	-	-	-
1032-2	Orchestra Room 2-18	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1033-1	Nurse Office	SK	Арр	5.87	6/26/2020	-	-	-	None	-	-	-
1033-2	Nurse Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1034-1	Faculty Room	SK	Арр	5.31	6/26/2020	-	-	-	None	-	-	-
1035-1	Custodial Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1035-2	Custodial Office Custodial Closet	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1036-1	Mens Bathroom by Main Office	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-1	Womens Bathroom by Main Office Gang @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-2	Womens Bathroom by Main Office Gang @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-3	Womens Bathroom by Main Office Gang @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-4	Womens Bathroom by Main Office Back Area	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1038-1	Principals Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1039-1	Boys Locker Room Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1039-2	Boys Locker Room Bathroom Back Vestibule	WF	Арр	23.6	6/26/2020				Additional Sampling Required			
1040-1	Girls Bathroom by Gym @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-2	Girls Bathroom by Gym @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-3	Girls Bathroom by Gym @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-4	Girls Bathroom by Gym @ D	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-5	Girls Bathroom by Gym @ E	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-1	Boys Bathroom by Gym @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-2	Boys Bathroom by Gym @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-3	Boys Bathroom by Gym @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-4	Boys Bathroom by Gym @ D	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1042-1	Custodial Closet by Gym	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1043-1	Computer Lab Room 3-2	WF	Арр	11.2	6/26/2020	-	-	-	None	-	-	-
1043-2	Computer Lab Room 3-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1044-1	Library Office / Break Room	SK	Арр	9.22	6/26/2020	-	-	-	None	-	-	-
1045-1	Girls Locker Room Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1046-1	Hall by Girls Locker Room	WF	Арр	1.61	6/26/2020	-	-	-	None	-	-	-
1047-1	Back Area between Rooms 3-1 & 3-3	SK	Арр	2.29	6/26/2020	-	-	-	None	-	-	-
1048-1	Back Area between Room 3-4 & 3-6	SK	Арр	14	6/26/2020	-	-	-	None	-	-	-
1049-1	Boys Bathroom by Room 3-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1050-1	Girls Bathroom by Room 3-4	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1051-1	Room 3-5	WF	Арр	6.94	6/26/2020	-	-	-	None	-	-	-
1051-2	Room 3-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1052-1	Room 3-8	WF	Арр	12.9	6/26/2020	-	-	-	None	-	-	-
1052-2	Room 3-8	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1053-1	Hall by Reading Room 4-0	WF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1053-2	Hall by Reading Room 4-0	BF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1054-1	Room 4-2	WF	Арр	24	6/26/2020				Additional Sampling Required			
1054-2	Room 4-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1055-1	Room 4-1	WF	Арр	13.2	6/26/2020	-	-	-	None	-	-	-
1055-2	Room 4-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1056-1	Room 4-4	WF	Арр	4.13	6/26/2020	-	-	-	None	-	-	-
1056-2	Room 4-4	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1057-1	Room 4-3	WF	Арр	12.4	6/26/2020	-	-	-	None	-	-	-
1057-2	Room 4-3	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1058-1	Room 4-6	WF	Арр	1.6	6/26/2020	-	-	-	None	-	-	-
1058-2	Room 4-6	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1059-1	Room 4-5	WF	Арр	9.17	6/26/2020	-	-	-	None	-	-	-
1059-2	Room 4-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1060-1	Room 4-8	WF	Арр	16.1	6/26/2020				Additional Sampling Required			



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1060-2	Room 4-8	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1061-1	Room 4-7	WF	App	2.02	6/26/2020	-	-	-	None	-	-	-
1061-2	Room 4-7	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1062-1	Room 4-10	WF	Арр	17	6/26/2020				Additional Sampling Required			
1062-2	Room 4-10	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1063-1	Room 4-9	WF	Арр		6/26/2020	-	-	-	Non-functional Sampling Required	-	-	-
1063-2	Room 4-9	SK	N/A		6/26/2020	-	-	=	Sign Required	-	-	-
1064-1	Room 4-12	WF	Арр	21.9	6/26/2020				Additional Sampling Required			
1064-2	Room 4-12	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1065-1	PTA Room 4-11	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1066-1	Storage Room 4-14	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
0001-1	Boiler Room	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Laboratory Report

NYE Report #: 2202331-14740

June 30, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Bretton Woods Elementary School Hauppauge, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 26, 2020. New York Environmental analyzed the samples on June 29, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	26 Jun 2020
Date Received:	26 Jun 2020
Date Analyzed:	29 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200626O054	1	Kitchen 1 Bay by Walk-in Freezer-SK; Initial	1.00	7.38	μg/L	
200626O055	2	Kitchen Pot Filler-SK; Initial	1.00	507	μg/L	E,H
200626O056	3	Kitchen 3 Bay (Left)-SK; Initial	1.00	71.7	μg/L	E,H
200626O057	4	Kitchen 3 Bay (Right)-SK; Initial	1.00	33.5	μg/L	Н
200626O058	5	Kitchen 2 Bay (Left)-SK; Initial	1.00	15.2	μg/L	Н
200626O059	6	Hall by Café-WF; Initial	1.00	<1.00	μg/L	
200626O060	7	Hall by Café-BF; Initial	1.00	<1.00	μg/L	
200626O061	8	Book Room 1-1-WF; Initial	1.00	3.32	μg/L	
200626O062	9	Book Room 1-1 Bathroom-SK; Initial	1.00	25.7	μg/L	Н
200626O063	10	Room 1-2-WF; Initial	1.00	4.66	μg/L	
200626O064	11	Room 1-2 Bathroom-SK; Initial	1.00	2.50	μg/L	
200626O065	12	Room 1-3-WF; Initial	1.00	2.08	μg/L	
200626O066	13	Room 1-3 Bathroom-SK; Initial	1.00	19.9	μg/L	Н
200626O067	14	Room 1-4-WF; Initial	1.00	10.2	μg/L	
200626O068	15	Room 1-4 Bathoom-SK; Initial	1.00	2.48	μg/L	
200626O069	16	Room 1-5-WF; Initial	1.00	8.19	μg/L	
200626O070	17	Room 1-5 Bathroom-SK; Initial	1.00	44.6	μg/L	Н
200626O071	18	Room 1-6-WF; Initial	1.00	3.37	μg/L	
200626O072	19	Room 1-6 Bathroom-SK; Initial	1.00	16.6	μg/L	Н
200626O073	20	Room 1-7-WF; Initial	1.00	3.56	μg/L	
200626O074	21	Room 1-7 Bathroom-SK; Initial	1.00	19.2	μg/L	Н
200626O075	22	Room 1-8-WF; Initial	1.00	102	μg/L	E,H
200626O076	23	Room 1-8 Bathroom-SK; Initial	1.00	27.9	μg/L	Н
200626O077	24	Room 1-9-WF; Initial	1.00	1.79	μg/L	
200626O078	25	Room 1-9 Bathroom-SK; Initial	1.00	12.0	μg/L	
200626O079	26	Art Room 1-10-WF; Initial	1.00	2.70	μg/L	



Date Collected:	26 Jun 2020
Date Received:	26 Jun 2020
Date Analyzed:	29 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead. Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200626O080	27	Art Room 1-10 Bathroom-SK; Initial	1.00	10.1	μg/L	
200626O081	28	Room 1-11-WF; Initial	1.00	3.85	μg/L	
200626O082	29	Room 1-11 Bathroom-SK; Initial	1.00	21.3	μg/L	Н
200626O083	30	Room 2-1-WF; Initial	1.00	5.34	μg/L	
200626O084	31	Room 2-1 Bathroom-SK; Initial	1.00	10.5	μg/L	
200626O085	32	Room 2-2-WF; Initial	1.00	1.51	μg/L	
200626O086	33	Room 2-2 Bathroom-SK; Initial	1.00	25.3	μg/L	Н
200626O087	34	Room 2-3-WF; Initial	1.00	18.8	μg/L	Н
200626O088	35	Room 2-3 Bathroom-SK; Initial	1.00	8.88	μg/L	
200626O089	36	Room 2-4-WF; Initial	1.00	1.72	μg/L	
200626O090	37	Room 2-4 Bathroom-SK; Initial	1.00	14.9	μg/L	
200626O091	38	Room 2-5-WF; Initial	1.00	7.44	μg/L	
200626O092	39	Room 2-5 Bathroom-SK; Initial	1.00	1.94	μg/L	
200626O093	40	Room 2-6-WF; Initial	1.00	1.16	μg/L	
200626O094	41	Room 2-6 Bathroom-SK; Initial	1.00	16.3	μg/L	Н
200626O095	42	Room 2-7-WF; Initial	1.00	2.11	μg/L	
200626O096	43	Room 2-7 Bathroom-SK; Initial	1.00	27.7	μg/L	Н
200626O097	44	Room 2-8-WF; Initial	1.00	6.49	μg/L	
200626O098	45	Room 2-8 Bathroom-SK; Initial	1.00	13.9	μg/L	
200626O099	46	Room 2-9-WF; Initial	1.00	142	μg/L	E,H
200626O100	47	Room 2-9 Bathroom-SK; Initial	1.00	109	μg/L	E,H
200626O101	48	Room 2-10-WF; Initial	1.00	8.54	μg/L	
200626O102	49	Room 2-12-WF; Initial	1.00	5.73	μg/L	
200626O103	50	Hall by Room 2-14-WF; Initial	1.00	<1.00	μg/L	
200626O104	51	ESL Room 2-14-WF; Initial	1.00	6.27	μg/L	
200626O105	52	Science Lab Room 2-16-WF; Initial	1.00	7.26	μg/L	
200626O106	53	Orchestra Room 2-18-WF; Initial	1.00	6.42	μg/L	



Date Collected:	26 Jun 2020
Date Received:	26 Jun 2020
Date Analyzed:	29 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200626O107	54	Nurse Office-SK; Initial	1.00	5.87	μg/L	
200626O108	55	Faculty Room-SK; Initial	1.00	5.31	μg/L	
200626O109	56	Boys Locker Room Bathroom Back Vestibule-WF; Initial	1.00	23.6	μg/L	Н
200626O110	57	Computer Lab Room 3-2-WF; Initial	1.00	11.2	μg/L	
200626O111	58	Library Office / Break Room-SK; Initial	1.00	9.22	μg/L	
200626O112	59	Hall by Girls Locker Room -WF; Initial	1.00	1.61	μg/L	
200626O113	60	Back Area between Rooms 3-1 & 3-3-SK; Initial	1.00	2.29	μg/L	
200626O114	61	Back Area between Room 3-4 & 3-6-SK; Initial	1.00	14.0	μg/L	
200626O115	62	Room 3-5-WF; Initial	1.00	6.94	μg/L	
200626O116	63	Room 3-8-WF; Initial	1.00	12.9	μg/L	
200626O117	64	Hall by Reading Room 4-0-WF; Initial	1.00	<1.00	μg/L	
200626O118	65	Hall by Reading Room 4-0-BF; Initial	1.00	<1.00	μg/L	
200626O119	66	Room 4-2-WF; Initial	1.00	24.0	μg/L	Н
200626O120	67	Room 4-1-WF; Initial	1.00	13.2	μg/L	
200626O121	68	Room 4-4-WF; Initial	1.00	4.13	μg/L	
200626O122	69	Room 4-3-WF; Initial	1.00	12.4	μg/L	
200626O123	70	Room 4-6-WF; Initial	1.00	1.60	μg/L	
200626O124	71	Room 4-5-WF; Initial	1.00	9.17	μg/L	
200626O125	72	Room 4-8-WF; Initial	1.00	16.1	μg/L	Н
200626O126	73	Room 4-7-WF; Initial	1.00	2.02	μg/L	
200626O127	74	Room 4-10-WF; Initial	1.00	17.0	μg/L	Н
200626O128	75	Room 4-12-WF; Initial	1.00	21.9	μg/L	Н

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix B



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen 1 Bay by Walk-in Freezer	SK	Арр	7.38	6/26/2020	-	-	-	None	-	-	-
1001-2	Kitchen Pot Filler	SK	Арр	507	6/26/2020				Additional Sampling Required			
1001-3	Kitchen 3 Bay (Left)	SK	Арр	71.7	6/26/2020				Additional Sampling Required			
1001-4	Kitchen 3 Bay (Right)	SK	Арр	33.5	6/26/2020				Additional Sampling Required			
1001-5	Kitchen 2 Bay (Left)	SK	Арр	15.2	6/26/2020				Additional Sampling Required			
1001-6	Kitchen 2 Bay (Right-Handwash)	SK	N/A		6/26/2020	-	-	1	None	SIGN	-	-
1001-7	Kitchen Bathroom	SK	N/A		6/26/2020	-	-	1	Sign Required	-	-	-
1002-1	Hall by Café	WF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1002-2	Hall by Café	BF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	=
1003-1	Custodial Closet by Café	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1004-1	Book Room 1-1	WF	Арр	3.32	6/26/2020	-	-	-	None	-	-	-
1004-2	Book Room 1-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1004-3	Book Room 1-1 Bathroom	SK	Арр	25.7	6/26/2020				Additional Sampling Required			
1005-1	Room 1-2	WF	Арр	4.66	6/26/2020	-	-	-	None	-	-	-
1005-2	Room 1-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1005-3	Room 1-2 Bathroom	SK	App	2.5	6/26/2020	-	-	-	None	-	-	-
1006-1	Room 1-3	WF	Арр	2.08	6/26/2020	-	-	-	None	-	-	-
1006-2	Room 1-3	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1006-3	Room 1-3 Bathroom	SK	Арр	19.9	6/26/2020				Additional Sampling Required			
1007-1	Room 1-4	WF	Арр	10.2	6/26/2020	-	-	-	None	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1007-2	Room 1-4	SK	N/A	2.48	6/26/2020	-	-	-	Sign Required	-	-	-
1007-3	Room 1-4 Bathoom	SK	Арр	2.48	6/26/2020	-	-	-	None	-	-	-
1008-1	Room 1-5	WF	Арр	8.19	6/26/2020	-	-	-	None	-	-	-
1008-2	Room 1-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1008-3	Room 1-5 Bathroom	SK	Арр	44.6	6/26/2020				Additional Sampling Required			
1009-1	Room 1-6	WF	Арр	3.37	6/26/2020	-	-	-	None	-	-	-
1009-2	Room 1-6	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1009-3	Room 1-6 Bathroom	SK	Арр	16.6	6/26/2020				Additional Sampling Required			
1010-1	Room 1-7	WF	Арр	3.56	6/26/2020	-	-	-	None	-	-	-
1010-2	Room 1-7	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1010-3	Room 1-7 Bathroom	SK	Арр	19.2	6/26/2020				Additional Sampling Required			
1011-1	Room 1-8	WF	Арр	102	6/26/2020				Additional Sampling Required			
1011-2	Room 1-8	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1011-3	Room 1-8 Bathroom	SK	Арр	27.9	6/26/2020				Additional Sampling Required			
1012-1	Room 1-9	WF	Арр	1.79	6/26/2020	-	-	-	None	-	-	-
1012-2	Room 1-9	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1012-3	Room 1-9 Bathroom	SK	Арр	12	6/26/2020	-	-	-	None	-	-	-
1013-1	Art Room 1-10	WF	Арр	2.7	6/26/2020	-	-	-	None	-	-	-
1013-2	Art Room 1-10	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1013-3	Art Room 1-10 Brush Wash	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1013-4	Art Room 1-10 Bathroom	SK	Арр	10.1	6/26/2020	-	-	-	None	-	-	-
1014-1	Room 1-11	WF	Арр	3.85	6/26/2020	-	-	-	None	-	-	-
1014-2	Room 1-11	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1014-3	Room 1-11 Bathroom	SK	Арр	21.3	6/26/2020				Additional Sampling Required			
1015-1	Room 2-1	WF	Арр	5.34	6/26/2020	-	-	-	None	-	-	-
1015-2	Room 2-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1015-3	Room 2-1 Bathroom	SK	Арр	10.5	6/26/2020	-	-	-	None	-	-	-
1016-1	Room 2-2	WF	Арр	1.51	6/26/2020	-	-	-	None	-	-	-
1016-2	Room 2-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1016-3	Room 2-2 Bathroom	SK	Арр	25.3	6/26/2020				Additional Sampling Required			
1017-1	Room 2-3	WF	Арр	18.8	6/26/2020				Additional Sampling Required			
1017-2	Room 2-3	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1017-3	Room 2-3 Bathroom	SK	Арр	8.88	6/26/2020	-	-	-	None	-	-	-
1018-1	Room 2-4	WF	Арр	1.72	6/26/2020	-	-	-	None	-	-	-
1018-2	Room 2-4	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1018-3	Room 2-4 Bathroom	SK	Арр	14.9	6/26/2020	-	-	-	None	-	-	-
1019-1	Room 2-5	WF	Арр	7.44	6/26/2020	-	-	-	None	-	-	-
1019-2	Room 2-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1019-3	Room 2-5 Bathroom	SK	Арр	1.94	6/26/2020	-	-	-	None	-	-	-
1020-1	Room 2-6	WF	Арр	1.16	6/26/2020	-	-	-	None	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1020-2	Room 2-6	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1020-3	Room 2-6 Bathroom	SK	Арр	16.3	6/26/2020				Additional Sampling Required			
1021-1	Room 2-7	WF	Арр	2.11	6/26/2020	-	-	-	None	-	-	-
1021-2	Room 2-7	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1021-3	Room 2-7 Bathroom	SK	Арр	27.7	6/26/2020				Additional Sampling Required			
1022-1	Room 2-8	WF	Арр	6.49	6/26/2020	-	-	1	None	1	-	-
1022-2	Room 2-8	SK	N/A		6/26/2020	-	-	-	Sign Required	1	-	ı
1022-3	Room 2-8 Bathroom	SK	Арр	13.9	6/26/2020	-	-	-	None	-	-	-
1023-1	Room 2-9	WF	Арр	142	6/26/2020				Additional Sampling Required			
1023-2	Room 2-9	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1023-3	Room 2-9 Bathroom	SK	Арр	109	6/26/2020				Additional Sampling Required			
1024-1	Room 2-10	WF	Арр	8.54	6/26/2020	-	-	-	None	-	-	-
1024-2	Room 2-10	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1025-1	Girls Bathroom by Room 2-10 @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1025-2	Girls Bathroom by Room 2-10 @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1025-3	Girls Bathroom by Room 2-10 @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1026-1	Boys Bathroom by Room 2-10 @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1026-2	Boys Bathroom by Room 2-10 @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1026-3	Boys Bathroom by Room 2-10 @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1027-1	Custodial Closet by Room 2-10	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1028-1	Room 2-12	WF	Арр	5.73	6/26/2020	-	-	-	None	-	-	-
1028-2	Room 2-12	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1029-1	Hall by Room 2-14	WF	App	<1.0	6/26/2020	-	-	-	None	-	-	-
1030-1	ESL Room 2-14	WF	App	6.27	6/26/2020	-	-	-	None	-	-	-
1030-2	ESL Room 2-14	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1031-1	Science Lab Room 2-16	WF	Арр	7.26	6/26/2020	-	-	-	None	-	-	-
1031-2	Science Lab Room 2-16	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1032-1	Orchestra Room 2-18	WF	App	6.42	6/26/2020	-	-	-	None	-	-	-
1032-2	Orchestra Room 2-18	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1033-1	Nurse Office	SK	Арр	5.87	6/26/2020	-	-	-	None	-	-	-
1033-2	Nurse Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1034-1	Faculty Room	SK	App	5.31	6/26/2020	-	-	-	None	-	-	-
1035-1	Custodial Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1035-2	Custodial Office Custodial Closet	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1036-1	Mens Bathroom by Main Office	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-1	Womens Bathroom by Main Office Gang @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-2	Womens Bathroom by Main Office Gang @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-3	Womens Bathroom by Main Office Gang @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1037-4	Womens Bathroom by Main Office Back Area	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1038-1	Principals Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1039-1	Boys Locker Room Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1039-2	Boys Locker Room Bathroom Back Vestibule	WF	Арр	23.6	6/26/2020				Additional Sampling Required			
1040-1	Girls Bathroom by Gym @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-2	Girls Bathroom by Gym @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-3	Girls Bathroom by Gym @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-4	Girls Bathroom by Gym @ D	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1040-5	Girls Bathroom by Gym @ E	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-1	Boys Bathroom by Gym @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-2	Boys Bathroom by Gym @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-3	Boys Bathroom by Gym @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1041-4	Boys Bathroom by Gym @ D	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1042-1	Custodial Closet by Gym	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1043-1	Computer Lab Room 3-2	WF	Арр	11.2	6/26/2020	-	-	-	None	-	-	-
1043-2	Computer Lab Room 3-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1044-1	Library Office / Break Room	SK	Арр	9.22	6/26/2020	-	-	-	None	-	-	-
1045-1	Girls Locker Room Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1046-1	Hall by Girls Locker Room	WF	Арр	1.61	6/26/2020	-	-	-	None	-	-	-
1047-1	Back Area between Rooms 3-1 & 3-3	SK	Арр	2.29	6/26/2020	-	-	-	None	-	-	-
1048-1	Back Area between Room 3-4 & 3-6	SK	Арр	14	6/26/2020	-	-	-	None	-	-	-
1049-1	Boys Bathroom by Room 3-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1050-1	Girls Bathroom by Room 3-4	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1051-1	Room 3-5	WF	Арр	6.94	6/26/2020	-	-	-	None	-	-	-
1051-2	Room 3-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1052-1	Room 3-8	WF	Арр	12.9	6/26/2020	-	-	-	None	-	-	-
1052-2	Room 3-8	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1053-1	Hall by Reading Room 4-0	WF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1053-2	Hall by Reading Room 4-0	BF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1054-1	Room 4-2	WF	Арр	24	6/26/2020				Additional Sampling Required			
1054-2	Room 4-2	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1055-1	Room 4-1	WF	Арр	13.2	6/26/2020	-	-	-	None	-	-	-
1055-2	Room 4-1	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1056-1	Room 4-4	WF	Арр	4.13	6/26/2020	-	-	-	None	-	-	-
1056-2	Room 4-4	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1057-1	Room 4-3	WF	Арр	12.4	6/26/2020	-	-	-	None	-	-	-
1057-2	Room 4-3	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1058-1	Room 4-6	WF	Арр	1.6	6/26/2020	-	-	-	None	-	-	-
1058-2	Room 4-6	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1059-1	Room 4-5	WF	Арр	9.17	6/26/2020	-	-	-	None	-	-	-
1059-2	Room 4-5	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1060-1	Room 4-8	WF	Арр	16.1	6/26/2020				Additional Sampling Required			



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1060-2	Room 4-8	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1061-1	Room 4-7	WF	Арр	2.02	6/26/2020	-	-	-	None	-	-	-
1061-2	Room 4-7	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1062-1	Room 4-10	WF	Арр	17	6/26/2020				Additional Sampling Required			
1062-2	Room 4-10	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1063-1	Room 4-9	WF	Арр		6/26/2020	-	-	-	Non-functional Sampling Required	-	-	-
1063-2	Room 4-9	SK	N/A		6/26/2020	-	-	=	Sign Required	-	-	=
1064-1	Room 4-12	WF	Арр	21.9	6/26/2020				Additional Sampling Required			
1064-2	Room 4-12	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1065-1	PTA Room 4-11	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1066-1	Storage Room 4-14	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
0001-1	Boiler Room	SS	N/A	_	6/26/2020	-	-	-	Sign Required	-	-	-



Laboratory Report

NYE Report #: 2202285-14719

June 29, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Forest Brooks Elementary, Hauppauge, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 25, 2020. New York Environmental analyzed the samples on June 26, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	25 Jun 2020
Date Received:	25 Jun 2020
Date Analyzed:	26 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200625Q001	1	Kitchen Food Prep-SK; Initial	1.00	14.7	μg/L	
200625Q002	2	Kitchen 3-Bay @ A-SK; Initial	1.00	5.93	μg/L	
200625Q003	3	Kitchen 3-Bay @ B-SPY; Initial	1.00	2.47	μg/L	
200625Q004	4	Kitchen Pot Filler-PF; Initial	1.00	9.41	μg/L	
200625Q005	5	Entrance to Wing 3-WF; Initial	1.00	1.12	μg/L	
200625Q006	6	Room 302-WF; Initial	1.00	3.94	μg/L	
200625Q007	7	Room 304-WF; Initial	1.00	11.6	μg/L	
200625Q008	8	Room 306-WF; Initial	1.00	2.04	μg/L	
200625Q009	9	Room 308-WF; Initial	1.00	16.8	μg/L	Н
200625Q010	10	Room 310 Bathroom-SK; Initial	1.00	9.01	μg/L	
200625Q011	11	Room 311-WF; Initial	1.00	2.40	μg/L	
200625Q012	12	Room 311 Bathroom-SK; Initial	1.00	38.9	μg/L	Н
200625Q013	13	Room 309-WF; Initial	1.00	2.69	μg/L	
200625Q014	14	Room 305-WF; Initial	1.00	3.72	μg/L	
200625Q015	15	Room 303-WF; Initial	1.00	28.7	μg/L	Н
200625Q016	16	Gym Locker Room-Room 505-SK; Initial	1.00	6.02	μg/L	
200625Q017	17	Entrance to Wing 2-WF; Initial	1.00	<1.00	μg/L	
200625Q018	18	Entrance to Wing 2-BF; Initial	1.00	<1.00	μg/L	
200625Q019	19	Room 202-WF; Initial	1.00	20.0	μg/L	Н
200625Q020	20	Room 204-WF; Initial	1.00	7.68	μg/L	
200625Q021	21	Room 204 Bathroom-SK; Initial	1.00	24.1	μg/L	Н
200625Q022	22	Room 206-WF; Initial	1.00	12.5	μg/L	
200625Q023	23	Room 206 Bathroom-SK; Initial	1.00	23.1	μg/L	Н
200625Q024	24	Room 208-WF; Initial	1.00	1.43	μg/L	
200625Q025	25	Room 208 Bathroom-SK; Initial	1.00	21.4	μg/L	Н
200625Q026	26	Room 210-WF; Initial	1.00	2.75	μg/L	



Date Collected:	25 Jun 2020
Date Received:	25 Jun 2020
Date Analyzed:	26 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead. Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200625Q027	27	Room 210 Bathroom-SK; Initial	1.00	21.2	μg/L	Н
200625Q028	28	Room 213-WF; Initial	1.00	1.17	μg/L	
200625Q029	29	Room 213 Bathroom-SK; Initial	1.00	14.4	μg/L	
200625Q030	30	Room 209 Bathroom-SK; Initial	1.00	31.6	μg/L	Н
200625Q031	31	Room 207-WF; Initial	1.00	4.97	μg/L	
200625Q032	32	Room 207 Bathroom-SK; Initial	1.00	3.56	μg/L	
200625Q033	33	Room 205 Bathroom-SK; Initial	1.00	14.0	μg/L	
200625Q034	34	Library Bathroom-SK; Initial	1.00	12.9	μg/L	
200625Q035	35	Room 106-WF; Initial	1.00	7.81	μg/L	
200625Q036	36	Room 106 Bathroom-SK; Initial	1.00	41.5	μg/L	Н
200625Q037	37	Room 108-SK; Initial	1.00	13.1	μg/L	
200625Q038	38	Room 110 Bathroom-SK; Initial	1.00	31.8	μg/L	Н
200625Q039	39	Room 109-WF; Initial	1.00	<1.00	μg/L	
200625Q040	40	Room 109 Bathroom-SK; Initial	1.00	36.2	μg/L	Н
200625Q041	41	Room 105-WF; Initial	1.00	8.63	μg/L	
200625Q042	42	Room 105 Bathroom-SK; Initial	1.00	19.2	μg/L	Н
200625Q043	43	Room 103-WF; Initial	1.00	<1.00	μg/L	
200625Q044	44	Room 103 Bathroom-SK; Initial	1.00	<1.00	μg/L	
200625Q045	45	Room 101-WF; Initial	1.00	<1.00	μg/L	
200625Q046	46	Room 101 Bathroom-SK; Initial	1.00	26.0	μg/L	Н
200625Q047	47	Nurse's Office-SK; Initial	1.00	4.45	μg/L	
200625Q048	48	Nurse's Office Bathroom-SK; Initial	1.00	4.70	μg/L	
200625Q049	49	Faculty Room-SK; Initial	1.00	2.26	μg/L	
200625Q050	50	Faculty Room-SPY; Initial	1.00	16.7	μg/L	Н
200625Q051	51	Room 406-WF; Initial	1.00	9.40	μg/L	
200625Q052	52	Room 408-WF; Initial	1.00	6.18	μg/L	
200625Q053	53	Room 412-WF; Initial	1.00	23.3	μg/L	Н



Date Collected:	25 Jun 2020
Date Received:	25 Jun 2020
Date Analyzed:	26 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200625Q054	54	Room 403-WF; Initial	1.00	19.7	μg/L	Н
200625Q055	55	Hallway by Room 401-WF; Initial	1.00	6.91	μg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Appendix C



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen Handwash	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1001-2	Kitchen Prep @ A (Left)	SK	Арр	1.05	6/30/2020	-	-	-	None	-	-	-
1001-3	Kitchen Prep @ B (Middle)	SPRAY	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1001-4	Kitchen Prep @ C (Right)	SK	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1001-5	Kitchen Pot Filler	SP	Арр	14.8	6/30/2020	-	-	-	None	-	-	-
1001-6	Kitchen by Exterior Exit	SP	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1001-7	Kitchen Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1002-1	Custodial Office	SS	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1003-1	Kitchen Snack Room	SK	Арр	6.8	6/30/2020	-	-	-	None	-	-	-
1004-1	Room S-1	WF	Арр	14.9	6/30/2020	-	-	-	None	-	-	-
1004-2	Room S-1	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1004-3	Room S-1 Bathroom	SK	Арр	1.33	6/30/2020	-	-	-	None	-	-	-
1005-1	Room S-3	WF	Арр	5.46	6/30/2020	-	-	-	None	-	-	-
1005-2	Room S-3	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1005-3	Room S-3 Bathroom	SK	Арр	5.12	6/30/2020	-	-	-	None	-	-	-
1006-1	Bathroom Across from Cafetorium	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1007-1	Hall by Room S-2	WF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1007-2	Hall by Room S-2	BF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1008-1	Room S-2	WF	Арр	7.34	6/30/2020	-	-	-	None	-	-	-
1008-2	Room S-2	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1008-3	Room S-2 Bathroom	SK	Арр	6.85	6/30/2020	-	-	-	None	-	-	-
1009-1	Room S-5	WF	Арр	1.57	6/30/2020	-	-	-	None	-	-	-
1009-2	Room S-5	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1009-3	Room S-5 Bathroom	SK	Арр	24.2	6/30/2020				Additional Sampling Required			
1010-1	Room S-4	WF	Арр	8.85	6/30/2020	-	-	-	None	-	-	-
1010-2	Room S-4	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1010-3	Room S-4 Bathroom	SK	Арр	1.48	6/30/2020	-	-	-	None	-	-	-
1011-1	Room S-7	WF	Арр	8.72	6/30/2020	-	-	-	None	-	-	-
1011-2	Room S-7	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1011-3	Room S-7 Bathroom	SK	Арр	4.48	6/30/2020	-	-	-	None	-	-	-
1012-1	Mens Bathroom by Room S-7 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1012-2	Mens Bathroom by Room S-7 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1013-1	Unisex Bathroom by Room S-7 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1013-2	Unisex Bathroom by Room S-7 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1014-1	Room S-6	WF	Арр	2.78	6/30/2020	-	-	-	None	-	-	-
1014-2	Room S-6	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1014-3	Room S-6 Bathroom	SK	Арр	1.11	6/30/2020	-	-	-	None	-	-	-
1015-1	Room S-9	WF	Арр	2.35	6/30/2020	-	-	-	None	-	-	-
1015-2	Room S-9	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1015-3	Room S-9 Bathroom	SK	Арр	2.3	6/30/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1016-1	Room S-8	WF	Арр	5.44	6/30/2020	-	-	-	None	-	-	-
1016-2	Room S-8	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1016-3	Room S-8 Bathroom	SK	Арр	1.91	6/30/2020	-	-	-	None	-	-	-
1017-1	Room S-11	WF	Арр	7.93	6/30/2020	-	-	-	None	-	-	-
1017-2	Room S-11	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1017-3	Room S-11 Bathroom	SK	Арр	2.32	6/30/2020	-	-	-	None	-	-	-
1018-1	Room S-10	WF	Арр	9.89	6/30/2020	-	-	-	None	-	-	-
1018-2	Room S-10	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1018-3	Room S-10 Bathroom	SK	Арр	2.1	6/30/2020	-	-	-	None	-	-	-
1019-1	Hall by Room S-10	WF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1019-2	Hall by Room S-10	BF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1020-1	Room S-13	WF	Арр	5.83	6/30/2020	-	-	-	None	-	-	-
1020-2	Room S-13	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1020-3	Room S-13 Bathroom	SK	Арр	4.77	6/30/2020	-	-	-	None	-	-	-
1021-1	Physical Education Office Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1022-1	Room S-15	WF	Арр	2.32	6/30/2020	-	-	-	None	-	-	-
1022-2	Room S-15	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1022-3	Room S-15 Bathroom	SK	Арр	7	6/30/2020	-	-	-	None	-	-	-
1023-1	Hall by Room S-17	WF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1024-1	Room S-17	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1025-1	Bathroom by Room S-17	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1026-1	Room S-19	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1027-1	Custodial Closet by Kiln Room (Storage #1)	SS	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1028-1	Girls Locker Room Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1029-1	PTA Room	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1029-2	PTA Room Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1030-1	Room M-10	WF	Арр		6/30/2020	-	-	-	N0n-functional Sampling Required	-	-	-
1030-2	Room M-10	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1030-3	Room M-10 Bathroom	SK	Арр	4.8	6/30/2020	-	-	-	None	-	-	-
1031-1	Boys Bathroom by Room M-12 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1031-2	Boys Bathroom by Room M-12 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1031-3	Boys Bathroom by Room M-12 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1032-1	Girls Bathroom by Room M-12 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1032-2	Girls Bathroom by Room M-12 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1032-3	Girls Bathroom by Room M-12 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1033-1	Room M-12	WF	Арр	2.89	6/30/2020	-	-	-	None	-	-	-
1034-1	Hall by Room M-12	WF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1035-1	Room M-11	WF	Арр	23.1	6/30/2020				Additional Sampling Required			
1035-2	Room M-11	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1035-3	Room M-11 Bathroom	SK	Арр	4.98	6/30/2020	-	-	-	None	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1036-1	Room M-14	WF	Арр	2.74	6/30/2020	-	-	-	None	-	-	-
1036-2	Room M-14	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1036-3	Room M-14 Bathroom	SK	Арр	40.8	6/30/2020				Additional Sampling Required			
1037-1	Room M-8	WF	Арр	8.57	6/30/2020	-	-	-	None	-	-	-
1037-2	Room M-8	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1037-3	Room M-8 Bathroom	SK	Арр	3.34	6/30/2020	-	-	-	None	-	-	-
1038-1	Nurses Office	SK	Арр	7.64	6/30/2020	-	-	-	None	-	-	-
1038-2	Nurses Office Bathroom	SK	Арр	8.49	6/30/2020	-	-	-	None	-	-	-
1038-3	Nurses Office Exam Room	SK	Арр	18.2	6/30/2020				Additional Sampling Required			
1039-1	Faculty Room M-5	WF	Арр	4.18	6/30/2020	-	-	-	None	-	-	-
1039-2	Faculty Room M-5	SK	Арр	2.97	6/30/2020	-	-	-	None	-	-	-
1039-3	Faculty Room M-5 Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1040-1	Administration Assistant Office Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1041-1	Main Office Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1042-1	Speech Office Bathroom	SK	Арр	1.42	6/30/2020	-	-	-	None	-	-	-
1043-1	Room M-6	WF	Арр	10.8	6/30/2020	-	-	-	None	-	-	-
1043-2	Room M-6	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1043-3	Room M-6 Bathroom	SK	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1044-1	Room M-3	WF	Арр	16	6/30/2020				Additional Sampling Required			
1044-2	Room M-3	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1044-3	Room M-3 Bathroom	SK	Арр	1.05	6/30/2020	-	-	-	None	-	-	-
1045-1	Room M-4	WF	Арр	1.92	6/30/2020	-	-	-	None	-	-	-
1045-2	Room M-4	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1045-3	Room M-4 Bathroom	SK	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
1046-1	Room M-1	WF	Арр	2.63	6/30/2020	-	-	-	None	-	-	-
1046-2	Room M-1	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1046-3	Room M-1 Bathroom	SK	App	<1.0	6/30/2020	-	-	-	None	-	-	-
1047-1	Hall by Room M-2	WF	App	<1.0	6/30/2020	-	-	-	None	-	-	-
1048-1	Room M-2	WF	App	2.27	6/30/2020	-	-	-	None	-	-	-
1048-2	Room M-2	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
1048-3	Room M-2 Bathroom	SK	Арр	2.27	6/30/2020	-	-	-	None	-	-	-
2001-1	Room 200	WF	App	3.6	6/30/2020	-	-	-	None	-	-	-
2001-2	Room 200	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2002-1	Room 201	WF	Арр	11.1	6/30/2020	-	-	-	None	-	-	-
2002-2	Room 201	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2003-1	Boys Bathroom by Room 200 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2003-2	Boys Bathroom by Room 200 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2003-3	Boys Bathroom by Room 200 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2004-1	Custodial Closet by Room 200	SS	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2005-1	Room 205	WF	Арр	12.6	6/30/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2005-2	Room 205	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2006-1	Room 202	WF	Арр	4.67	6/30/2020	-	-	-	None	-	-	-
2006-2	Room 202	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2007-1	Hall by Room 202	WF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
2008-1	Room 207	WF	App	3.04	6/30/2020	-	-	-	None	-	-	-
2008-2	Room 207	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2009-1	Room 204	WF	App	5.54	6/30/2020	-	-	-	None	-	-	-
2009-2	Room 204	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2010-1	Psychologist Room 209	SK	Арр	6.63	6/30/2020	-	-	-	None	-	-	-
2011-1	Room 206	WF	Арр	8.5	6/30/2020	-	-	-	None	-	-	-
2011-2	Room 206	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2012-1	Room 213	WF	Арр	7.05	6/30/2020	-	-	-	None	-	-	-
2012-2	Room 213	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2013-1	Room 208	WF	Арр	21	6/30/2020				Additional Sampling Required			
2013-2	Room 208	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2014-1	Hall by Room 208	WF	App		6/30/2020	-	-	-	Non-functional Sampling Required	-	-	-
2014-2	Hall by Room 208	BF	Арр		6/30/2020	-	-	-	Non-functional Sampling Required	-	-	-
2015-1	Room 215	WF	Арр		6/30/2020	-	-	-	Non-functional Sampling Required	-	-	-
2015-2	Room 215	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2016-1	Room 210	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2017-1	Girls Bathroom by Room 210 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2017-2	Girls Bathroom by Room 210 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2018-1	Custodial Closet by Room 210	SS	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2019-1	Room 212	WF	Арр	5.17	6/30/2020	-	-	-	None	-	-	-
2019-2	Room 212	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2020-1	Room 217	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2021-1	Room 214	WF	Арр	7.82	6/30/2020	-	-	-	None	-	-	-
2021-2	Room 214	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2022-1	Staff Toliet by Room 214	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-
2023-1	Library Break Room	WF	Арр	4.29	6/30/2020	-	-	-	None	-	-	-
2023-2	Library Break Room	SK	Арр	3.45	6/30/2020	-	-	-	None	-	-	-
2024-1	Hall by Room 216	WF	Арр	<1.0	6/30/2020	-	-	-	None	-	-	-
2025-1	Room 216	SK	N/A		6/30/2020	-	-	-	Sign Required	-	-	-



Laboratory Report

NYE Report #: 2202419-14801

July 6, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Pines Elementary School Hauppague, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on July 02, 2020. New York Environmental analyzed the samples on July 03, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,
Li Tsang, Laboratory Director

Date Collected:	30 Jun 2020
Date Received:	02 Jul 2020
Date Analyzed:	03 Jul 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200702O004	1	Kitchen Prep @ A (Left)-SK; Initial	1.00	1.05	μg/L	
200702O005	2	Kitchen Prep @ B (Middle)-SPRAY; Initial	1.00	<1.00	μg/L	
200702O006	3	Kitchen Prep @ C (Right)-SK; Initial	1.00	<1.00	μg/L	
200702O007	4	Kitchen Pot Filler-SP; Initial	1.00	14.8	μg/L	
200702O008	5	Kitchen Snack Room-SK; Initial	1.00	6.80	μg/L	
200702O009	6	Room S-1-WF; Initial	1.00	14.9	μg/L	
2007020010	7	Room S-1 Bathroom-SK; Initial	1.00	1.33	μg/L	
2007020011	8	Room S-3-WF; Initial	1.00	5.46	μg/L	
2007020012	9	Room S-3 Bathroom-SK; Initial	1.00	5.12	μg/L	
200702O013	10	Hall by Room S-2-WF; Initial	1.00	<1.00	μg/L	
200702O014	11	Hall by Room S-2-BF; Initial	1.00	<1.00	μg/L	
200702O015	12	Room S-2-WF; Initial	1.00	7.34	μg/L	
200702O016	13	Room S-2 Bathroom-SK; Initial	1.00	6.85	μg/L	
200702O017	14	Room S-5-WF; Initial	1.00	1.57	μg/L	
200702O018	15	Room S-5 Bathroom-SK; Initial	1.00	24.2	μg/L	Н
200702O019	16	Room S-4-WF; Initial	1.00	8.85	μg/L	
200702O020	17	Room S-4 Bathroom-SK; Initial	1.00	1.48	μg/L	
200702O021	18	Room S-7-WF; Initial	1.00	8.72	μg/L	
200702O022	19	Room S-7 Bathroom-SK; Initial	1.00	4.48	μg/L	
200702O023	20	Room S-6-WF; Initial	1.00	2.78	μg/L	
200702O024	21	Room S-6 Bathroom-SK; Initial	1.00	1.11	μg/L	
200702O025	22	Room S-9-WF; Initial	1.00	2.35	μg/L	
200702O026	23	Room S-9 Bathroom-SK; Initial	1.00	2.30	μg/L	
200702O027	24	Room S-8-WF; Initial	1.00	5.44	μg/L	
200702O028	25	Room S-8 Bathroom-SK; Initial	1.00	1.91	μg/L	
200702O029	26	Room S-11-WF; Initial	1.00	7.93	μg/L	



Date Collected:	30 Jun 2020
Date Received:	02 Jul 2020
Date Analyzed:	03 Jul 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead. Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200702O030	27	Room S-11 Bathroom-SK; Initial	1.00	2.32	μg/L	
2007020031	28	Room S-10-WF; Initial	1.00	9.89	μg/L	
200702O032	29	Room S-10 Bathroom-SK; Initial	1.00	2.10	μg/L	
200702O033	30	Hall by Room S-10-WF; Initial	1.00	<1.00	μg/L	
200702O034	31	Hall by Room S-10-BF; Initial	1.00	<1.00	μg/L	
200702O035	32	Room S-13-WF; Initial	1.00	5.83	μg/L	
200702O036	33	Room S-13 Bathroom-SK; Initial	1.00	4.77	μg/L	
200702O037	34	Room S-15-WF; Initial	1.00	2.32	μg/L	
200702O038	35	Room S-15 Bathroom-SK; Initial	1.00	7.00	μg/L	
200702O039	36	Hall by Room S-17-WF; Initial	1.00	<1.00	μg/L	
200702O040	37	Room M-10 Bathroom-SK; Initial	1.00	4.80	μg/L	
200702O041	38	Room M-12-WF; Initial	1.00	2.89	μg/L	
200702O042	39	Hall by Room M-12-WF; Initial	1.00	<1.00	μg/L	
200702O043	40	Room M-11-WF; Initial	1.00	23.1	μg/L	Н
200702O044	41	Room M-11 Bathroom-SK; Initial	1.00	4.98	μg/L	
200702O045	42	Room M-14-WF; Initial	1.00	2.74	μg/L	
200702O046	43	Room M-14 Bathroom-SK; Initial	1.00	40.8	μg/L	Н
200702O047	44	Room M-8-WF; Initial	1.00	8.57	μg/L	
200702O048	45	Room M-8 Bathroom-SK; Initial	1.00	3.34	μg/L	
200702O049	46	Nurses Office-SK; Initial	1.00	7.64	μg/L	
200702O050	47	Nurses Office Bathroom-SK; Initial	1.00	8.49	μg/L	
200702O051	48	Nurses Office Exam Room-SK; Initial	1.00	18.2	μg/L	Н
200702O052	49	Faculty Room M-5-WF; Initial	1.00	4.18	μg/L	
200702O053	50	Faculty Room M-5-SK; Initial	1.00	2.97	μg/L	
200702O054	51	Speech Office Bathroom-SK; Initial	1.00	1.42	μg/L	
200702O055	52	Room M-6-WF; Initial	1.00	10.8	μg/L	
200702O056	53	Room M-6 Bathroom-SK; Initial	1.00	<1.00	μg/L	



Date Collected:	30 Jun 2020
Date Received:	02 Jul 2020
Date Analyzed:	03 Jul 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200702O057	54	Room M-3-WF; Initial	1.00	16.0	μg/L	Н
200702O058	55	Room M-3 Bathroom-SK; Initial	1.00	1.05	μg/L	
200702O059	56	Room M-4-WF; Initial	1.00	1.92	μg/L	
2007020060	57	Room M-4 Bathroom-SK; Initial	1.00	<1.00	μg/L	
200702O061	58	Room M-1-WF; Initial	1.00	2.63	μg/L	
200702O062	59	Room M-1 Bathroom-SK; Initial	1.00	<1.00	μg/L	
200702O063	60	Hall by Room M-2-WF; Initial	1.00	<1.00	μg/L	
200702O064	61	Room M-2-WF; Initial	1.00	2.27	μg/L	
200702O065	62	Room M-2 Bathroom-SK; Initial	1.00	2.27	μg/L	
200702O066	63	Room 200-WF; Initial	1.00	3.60	μg/L	
2007020067	64	Room 201-WF; Initial	1.00	11.1	μg/L	
200702O068	65	Room 205-WF; Initial	1.00	12.6	μg/L	
200702O069	66	Room 202-WF; Initial	1.00	4.67	μg/L	
2007020070	67	Hall by Room 202-WF; Initial	1.00	<1.00	μg/L	
2007020071	68	Room 207-WF; Initial	1.00	3.04	μg/L	
200702O072	69	Room 204-WF; Initial	1.00	5.54	μg/L	
200702O073	70	Psychologist Room 209-SK; Initial	1.00	6.63	μg/L	
2007020074	71	Room 206-WF; Initial	1.00	8.50	μg/L	
2007020075	72	Room 213-WF; Initial	1.00	7.05	μg/L	
2007020076	73	Room 208-WF; Initial	1.00	21.0	μg/L	Н
2007020077	74	Room 212-WF; Initial	1.00	5.17	μg/L	
2007020078	75	Room 214-WF; Initial	1.00	7.82	μg/L	
200702O079	76	Library Break Room-WF; Initial	1.00	4.29	μg/L	
200702O080	77	Library Break Room-SK; Initial	1.00	3.45	μg/L	
200702O081	78	Hall by Room 216-WF; Initial	1.00	<1.00	μg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

H: Sample result exceeds applicable regulatory limit.



Appendix D



Whiporwil Elementary School

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1001-1	Kitchen	SK	Арр	5.39	6/26/2020	-	-	-	None	-	-	-
1001-2	Kitchen 4-Bay @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1001-3	Kitchen 4-Bay @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1001-4	Kitchen 4-Bay @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1001-5	Kitchen 4-Bay @ D	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1001-6	Kitchen Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1002-1	Accounts Payable Kitchenette	SK	Арр	8.11	6/26/2020	-	-	-	None	-	-	-
1002-2	Accounts Payable	SPY	Арр	99.2	6/26/2020				Additional Sampling Required			
1002-3	Accounts Payable Bathroom	SK	N/A		6/26/2020	-	-	=	Sign Required	-	-	-
1003-1	Districk Clerk Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1004-1	Pupil Personnel Services Kitchenette	SK	Арр	58.4	6/26/2020				Additional Sampling Required			
1004-2	Pupil Personnel Services Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1005-1	Conference Room	SK	Арр	22.6	6/26/2020				Additional Sampling Required			
1005-2	Conference Room Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1006-1	Curriculum & Instruction Office	SK	Арр	4.99	6/26/2020	-	-	-	None	-	-	-
1006-2	Curriculum & Instruction Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1007-1	Superintentent of Schools Bathroom	SK	Арр	3.3	6/26/2020	-	-	-	None	-	-	-
1008-1	Business Office Bathroom	SK	Арр	3.26	6/26/2020	-	-	-	None	-	-	-
1009-1	Personnel Office Bathroom	SK	Арр	4.59	6/26/2020	-	-	-	None	-	-	-
1010-1	Hall by New Beginnings	WF	Арр	4.57	6/26/2020	-	-	-	None	-	-	-

lauppaug Vhiporwil	e UFSD Elementary Scho
Space #	Sample

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1011-1	Room 10	SK	Арр	1.8	6/26/2020	-	-	-	None -		-	-
1001-2	Room 10 Handwash	SK	N/A		6/26/2020	-	-	-	None	SIGN	-	-
1012-1	Room 12 Handwash	SK	N/A		6/26/2020	-	-	-	None	SIGN	-	-
1013-1	Room 14	SK	Арр	1.6	6/26/2020	-	-	-	None	-	-	-
1013-2	Room 14 Bathroom	SK	Арр	5.37	6/26/2020	-	-	-	None	-	-	-
1014-1	Room 16	SK	Арр	1.1	6/26/2020	-	-	-	None	-	-	-
1014-2	Room 16 Bathroom	SK	Арр	6.1	6/26/2020	-	-	-	None	-	-	-
1015-1	Room 19	SK	Арр	7.19	6/26/2020	-	-	-	None	-	-	-
1015-2	Room 19 Bathroom	SK	Арр	1.91	6/26/2020	-	-	-	None	-	-	-
1016-1	Room 17	SK	Арр	5.7	6/26/2020	-	-	-	None	-	-	-
1016-2	Room 17 Bathroom	SK	Арр	4.56	6/26/2020	-	-	-	None	-	-	-
1017-1	Room 15	SK	Арр	7.44	6/26/2020	-	-	-	None	-	-	-
1017-2	Room 15 Bathroom	SK	Арр	1.46	6/26/2020	-	-	-	None	-	-	-
1018-1	Room 13	SK	Арр	3.13	6/26/2020	-	-	-	None	-	-	-
1018-2	Room 13 Bathoom	SK	Арр	4.57	6/26/2020	-	-	-	None	-	-	-
1019-1	Room 11	SK	Арр	2.45	6/26/2020	-	-	-	None	-	-	-
1019-2	Room 11 Bathroom	SK	Арр	2.86	6/26/2020	-	-	-	None -		-	-
1020-1	Buildings & Grounds Kitchenette	SK	Арр	19.2	6/26/2020				Additional Sampling Required			
1021-1	Buildings & Grounds Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1022-1	Transportation Bathroom/Kitchenette	SK	Арр	38.8	6/26/2020				Additional Sampling Required			



Hauppauge UFSD Whiporwil Elementary School

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1023-1	Hall by the Opportunity Pre-School	WF	Арр	<1.0	6/26/2020	-	-	-	None	ne -		-
1023-2	Hall by the Opportunity Pre-School	BF	Арр	<1.0	6/26/2020	-	-	-	None	-	-	-
1024-1	Room 40	SK	Арр	19.5	6/26/2020				Additional Sampling Required			
1024-2	Room 40	WF	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1025-1	Room 42	SK	Арр	17.8	6/26/2020				Additional Sampling Required			
1025-2	Room 42	WF	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1026-1	Room 44	SK	Арр	6.67	6/26/2020	-	-	-	None	-	-	-
1026-2	Room 44	WF	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1027-1	Room 46	SK	Арр	4.7	6/26/2020	-	-	-	None	-	-	-
1027-2	Room 46	WF	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1028-1	Room 48	SK	Арр	42.3	6/26/2020				Additional Sampling Required			
1028-2	Room 48	WF	Арр	8.54	6/26/2020	-	-	-	None	-	-	-
1029-1	Room 47	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1029-2	Room 47	WF	Арр	4.54	6/26/2020	-	-	-	None	-	-	-
1030-1	Room 45	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1030-2	Room 45	WF	Арр	2.04	6/26/2020	-	-	-	None	-	-	-
1031-1	Room 43	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1031-2	Room 43	WF	Арр	21.8	6/26/2020				Additional Sampling Required			
1032-1	Room 41	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	=
1032-2	Room 41	WF	N/A		6/26/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1033-1	Girl's Bathroom by Nurse's Office @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1033-2	Girl's Bathroom by Nurse's Office @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1033-3	Girl's Bathroom by Nurse's Office @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1033-4	Girl's Bathroom by Nurse's Office @ D	SK	Арр	10.3	6/26/2020	-	-	-	None	-	-	-
1034-1	Opportunity Pre-School Nurse	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1035-1	Custoial Closet by Room 30A	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1036-1	Boy's Bathroom by Room 30A @ A	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1036-2	Boy's Bathroom by Room 30A @ B	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1036-3	Boy's Bathroom by Room 30A @ C	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1036-4	Boy's Bathroom by Room 30A @ D	SK	Арр		6/26/2020	-	-	-	None	-	-	-
1037-1	Room 30	SK	Арр	12.8	6/26/2020	-	-	-	None	-	-	-
1038-1	Room 32	SK	Арр	72.9	6/26/2020				Additional Sampling Required			
1038-2	Room 32	SPY	Арр	30.4	6/26/2020				Additional Sampling Required			
1039-1	Room 34	SK	Арр	9.04	6/26/2020	-	-	-	None	-	-	-
1040-1	Room 36	WF	N/A		6/26/2020	-	-	-	None	CAPPED	-	-
1040-2	Room 36	SK	Арр	11.9	6/26/2020	-	-	-	None	-	-	-
1041-1	Room 33	SK	Арр	12.2	6/26/2020	-	-	-	None	-	-	-
1041-2	Room 33	WF	N/A		6/26/2020	-	-	-	None	CAPPED	-	-
1042-1	Room 31	SK	N/A		6/26/2020	-	-	-	None	SIGN	-	-
1042-2	Room 31	WF	N/A		6/26/2020	-	-	-	None	CAPPED	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1043-1	Speech & Language Office Bathroom	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1044-1	Unisex Bathroom Across from Transportation	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1045-1	Women's Bathroom Across from Transportation	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1046-1	Men's Bathroom Across from Transportation	SK	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1047-1	Custodial Closet by Boiler Room	SS	N/A		6/26/2020	-	-	-	Sign Required	-	-	-
1048-1	Custodial Office	SK	Арр	8.97	6/26/2020	-	-	-	None	-	-	-



Laboratory Report

NYE Report #: 2202328-14739

July 6, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Whiporwil School Hauppauge, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 26, 2020. New York Environmental analyzed the samples on June 29, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	26 Jun 2020
Date Received:	26 Jun 2020
Date Analyzed:	29 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200626O007	1	Kitchen - SK; Initial	1.00	5.39	μg/L	
200626O008	2	Accounts Payable Kitchenette - SK; Initial	1.00	8.11	μg/L	
200626O009	3	Accounts Payable - SPY; Initial	1.00	99.2	μg/L	E,H
200626O010	4	Pupil Personnel Services Kitchenette - SK; Initial	1.00	58.4	μg/L	E,H
200626O011	5	Conference Room - SK; Initial	1.00	22.6	μg/L	Н
200626O012	6	Curriculum & Instruction Office - SK; Initial	1.00	4.99	μg/L	
200626O013	7	Superintentent of Schools Bathroom - SK; Initial	1.00	3.30	μg/L	
200626O014	8	Business Office Bathroom - SK; Initial	1.00	3.26	μg/L	
200626O015	9	Personnel Office Bathroom - SK; Initial	1.00	4.59	μg/L	
200626O016	10	Hall by New Beginnings - WF; Initial	1.00	4.57	μg/L	
200626O017	11	Curriculum & Instruction Office - SK; Initial	1.00	1.80	μg/L	
200626O018	12	Superintentent of Schools Bathroom - SK; Initial	1.00	1.60	μg/L	
200626O019	13	Business Office Bathroom - SK; Initial	1.00	5.37	μg/L	
200626O020	14	Personnel Office Bathroom - SK; Initial	1.00	1.10	μg/L	
200626O021	15	Hall by New Beginnings - WF; Initial	1.00	6.10	μg/L	
200626O022	16	Room 19 - SK; Initial	1.00	7.19	μg/L	
200626O023	17	Room 19 Bathroom - SK; Initial	1.00	1.91	μg/L	
200626O024	18	Room 17 - SK; Initial	1.00	5.70	μg/L	
200626O025	19	Room 17 Bathroom - SK; Initial	1.00	4.56	μg/L	
200626O026	20	Room 15 - SK; Initial	1.00	7.44	μg/L	
200626O027	21	Room 15 Bathroom - SK; Initial	1.00	1.46	μg/L	
200626O028	22	Room 13 - SK; Initial	1.00	3.13	μg/L	
200626O029	23	Room 13 Bathoom - SK; Initial	1.00	4.57	μg/L	
200626O030	24	Room 11 - SK; Initial	1.00	2.45	μg/L	
200626O031	25	Room 11 Bathroom - SK; Initial	1.00	2.86	μg/L	
200626O032	26	Buildings & Grounds Kitchenette - SK; Initial	1.00	19.2	μg/L	Н



Date Collected:	26 Jun 2020				
Date Received:	26 Jun 2020				
Date Analyzed:	29 Jun 2020				

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200626O033	27	Transportation Bathroom - SK; Initial	1.00	38.8	μg/L	Н
200626O034	28	Hall by the Opportunity Pre-School - WF; Initial	1.00	<1.00	μg/L	
200626O035	29	Hall by the Opportunity Pre-School - BF; Initial	1.00	<1.00	μg/L	
200626O036	30	Room 40 - SK; Initial	1.00	19.5	μg/L	Н
200626O037	31	Room 42 - SK; Initial	1.00	17.8	μg/L	Н
200626O038	32	Room 44 - SK; Initial	1.00	6.67	μg/L	
200626O039	33	Room 46 - SK; Initial	1.00	4.70	μg/L	
200626O040	34	Room 48 - SK; Initial	1.00	42.3	μg/L	Н
200626O041	35	Room 48 - WF; Initial	1.00	8.54	μg/L	
200626O042	36	Room 47 - WF; Initial	1.00	4.54	μg/L	
200626O043	37	Room 45 - WF; Initial	1.00	2.04	μg/L	
200626O044	38	Room 43 - WF; Initial	1.00	21.8	μg/L	Н
200626O045	39	Girl's Bathroom by Nurse's Office @ D - SK; Initial	1.00	10.3	μg/L	
200626O046	40	Room 30 - SK; Initial	1.00	12.8	μg/L	
200626O047	41	Room 32 - SK; Initial	1.00	72.9	μg/L	E,H
200626O048	42	Room 32 - SPY; Initial	1.00	30.4	μg/L	Н
200626O049	43	Room 34 - SK; Initial	1.00	9.04	μg/L	
200626O050	44	Room 36 - WF; Initial	1.00	11.9	μg/L	
200626O051	45	Room 33 - SK; Initial	1.00	12.2	μg/L	
200626O052	46	Room 31 - SK; Initial	1.00	9.10	μg/L	
200626O053	47	Custodial Office - SK; Initial	1.00	8.97	μg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix E



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1000-1	Kitchen Handwash @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1000-2	Kitchen 2 Bay	SK	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1000-3	Kicthen Handwash @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1000-4	Kitchen Dishwash Station	SPRAY	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1000-5	Kitchen Handwash @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1000-6	Kitchen 3 Bay @ A (Left)	SK	Арр	1.45	6/25/2020	-	-	-	None	-	-	-
1000-7	Kitchen 3 Bay @ B (Right)	SK	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1000-8	Kitchen Custodial Closet	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1000-9	Kitchen Pot Filler @ A (Left)	SP	Арр	109	6/25/2020				Additional Sampling Required			
1000-10	Kitchen Pot Filler @ B (Right)	SP	Арр	3.12	6/25/2020	-	-	-	None	-	-	-
1001-1	Serving Line Handwash @ A (Left)	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1001-2	Serving Line 1 Bay @ A (Left)	SK	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1001-3	Serving Line 1 Bay @ B (Right)	SK	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1001-4	Serving Line Handwash @ B (Right)	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1002-1	Kitchen Bathroom	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1003-1	Café @ A (Left)	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1003-2	Café @ B (Right)	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1004-1	Faculty Café	SK	Арр	2.66	6/25/2020	-	-	-	None	-	-	-
1005-1	Café Snack Room	SK	Арр	3.75	6/25/2020	-	-	-	None	-	-	-
1006-1	Hall by Café	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1006-2	Hall by Café	BF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1007-1	Girls Bathroom by Room S-13 @ A	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1007-2	Girls Bathroom by Room S-13 @ B	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1008-1	Boys Bathroom by Room S-13 @ A	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1008-2	Boys Bathroom by Room S-13 @ B	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1009-1	Womens Bathroom by Room S-14 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1009-2	Womens Bathroom by Room S-14 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1010-1	Mens Bathroom by Room S-14	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1011-1	Custodial Closet by Room S-14	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1012-1	Room C-12	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1013-1	Auxilary Gym	WF	Арр	15.9	6/25/2020				Additional Sampling Required			
1014-1	Womens Coaches Office Bathroom	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1015-1	Hall by Auxilary Gym	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1015-2	Hall by Auxilary Gym	BF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1016-1	Girls Locker Room Bathroom @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1016-2	Girls Locker Room Bathroom @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1016-3	Girls Locker Room Bathroom @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1016-4	Girls Locker Room @ A (Left)	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1016-5	Girls Locker Room @ B (Right)	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1017-1	Boys Locker Room @ A (Left)	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1017-2	Boys Locker Room @ B (Right)	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1017-3	Boys Locker Room Bathroom @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1017-4	Boys Locker Room Bathroom @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1017-5	Boys Locker Room Bathroom @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1018-1	Boys Coaches Office Bathroom	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1019-1	Room C-11	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1020-1	Hall by Room C-10	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1021-1	Boys Bathroom by Room C-10 @ A	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1021-2	Boys Bathroom by Room C-10 @ B	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1021-3	Boys Bathroom by Room C-10 @ C	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1022-1	Girls Bathroom by Room C-10 @ A	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1022-2	Girls Bathroom by Room C-10 @ B	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1023-1	Music Library Bathroom	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1024-1	Band/Orchestra Room C-102	WF	Арр	1.02	6/25/2020	-	-	-	None	-	-	-
1025-1	Band/Orchestra Storage Room C-103	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1026-1	Vocal Room C-106	WF	App	<1.0	6/25/2020	-	-	-	None	-	-	-
1027-1	Tech Room M-11 @ A (Left)	SK	Арр	6.5	6/25/2020	-	-	-	None	-	-	-
1027-2	Tech Room M-11 @ B (Middle)	SK	Арр	11.7	6/25/2020	-	-	-	None	-	-	-
1027-3	Tech Room M-11 @ C (Right)	SK	Арр	82.4	6/25/2020				Additional Sampling Required			
1028-1	Principals Office Bathroom	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1029-1	Nurses Office by Bathroom	SK	Арр	1.14	6/25/2020	-	-	-	None	-	-	-
1029-2	Nurses Office by Main Desk	SK	Арр	33.7	6/25/2020				Additional Sampling Required			
1029-3	Nurses Office Bathroom	SK	N/A		6/25/2020	-	-	-	Mixed Valve	-	-	-
1030-1	Hall by Nurses Office	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1030-2	Hall by Nurses Office	BF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1031-1	Womens Bathroom by Nurses Office @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1031-2	Womens Bathroom by Nurses Office @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1032-1	Mens Bathroom by Nurses Office @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1032-2	Mens Bathroom by Nurses Office @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1032-3	Mens Bathroom by Nurses Office @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1033-1	Psychologist Office M-14 Bathroom	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1034-1	Custodial Closet by AP/Guidance Office	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1035-1	Hall by Room A-13	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
1036-1	Administration Office A-19A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1037-1	Girls Bathroom by Room A-111 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1037-2	Girls Bathroom by Room A-111 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1037-3	Girls Bathroom by Room A-111 @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1038-1	Boys Bathroom by Room A-111 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1038-2	Boys Bathroom by Room A-111 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1038-3	Boys Bathroom by Room A-111 @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1039-1	Science Room A-113	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1040-1	Science Room A-115 Teachers Station	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1040-2	Science Room A-115 Counter @ A	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1040-3	Science Room A-115 Counter @ B	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1040-4	Science Room A-115 Counter @ C	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1041-1	Science Room A-114 Teachers Station	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1041-2	Science Room A-114 Counter @ A	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1041-3	Science Room A-114 Counter @ B	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1041-4	Science Room A-114 Counter @ C	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1042-1	Custodial Closet by Science Room A-114	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1043-1	Custodial Closet by Room S-11	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1044-1	Science Room S-11/S-12 Teachers Station	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1044-2	Science Room S-11/S-12 Counter @ A (Left)	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1044-3	Science Room S-11/S-12 Counter @ B (Right) SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1044-4	Science Room S-11/S-12 Prep Room	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
1045-1	Girls Bathroom by Room B-14 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1045-2	Girls Bathroom by Room B-14 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1045-3	Girls Bathroom by Room B-14 @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1046-1	Boys Bathrom by Room B-14 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
1046-2	Boys Bathrom by Room B-14 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-



lauppaug	e Middle School				School	water out	et ilivelitoi	· y		Lead III School Dillik	ing water i	rogram zoz
Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
1046-3	Boys Bathrom by Room B-14 @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	1
0000-1	Basement Boiler Room	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	1
2000-1	Hall by Library	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	1
2000-2	Hall by Library	BF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
2001-1	Girls Bathroom by Library @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2001-2	Girls Bathroom by Library @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2002-1	Boys Bathroom by Library @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2002-2	Boys Bathroom by Library @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2003-1	Library Break Room	SK	Арр	20.9	6/25/2020				Additional Sampling Required			
2004-1	Womens Bathroom by Library @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	1
2004-2	Womens Bathroom by Library @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	1
2005-1	Mens Bathroom by Library	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2006-1	Art Room S-29 Counter @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2006-2	Art Room S-29 Counter @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2006-3	Art Room S-29 Storage Area @ A (Left)	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2006-4	Art Room S-29 Storage Area @ B (Right)	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2007-1	Hall by Room C-24	WF	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2008-1	Art Room C-24 Orange Station (Left)	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-



Art Room C-24 Yellow Station (Middle)

Art Room C-24 Green Station (Right)

SK

SK

N/A

N/A

2008-2

2008-3

Sign Required

Sign Required

6/25/2020

6/25/2020

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2009-1	Home Ec Room C-23 Station 1	SK	Арр	9.35	6/25/2020	-	-	-	None	-	-	-
2009-2	Home Ec Room C-23 Station 2	SK	Арр	15.2	6/25/2020				Additional Sampling Required			
2009-3	Home Ec Room C-23 Station 3	SK	Арр	20.7	6/25/2020				Additional Sampling Required			
2009-4	Home Ec Room C-23 Station 4	SK	Арр	64.4	6/25/2020				Additional Sampling Required			
2010-1	Home Ec Room C-22 Station 1	SK	Арр	16.2	6/25/2020				Additional Sampling Required			
2010-2	Home Ec Room C-22 Station 2	SK	Арр	5.28	6/25/2020	-	-	-	None	-	-	-
2010-3	Home Ec Room C-22 Station 3	SK	Арр	2.53	6/25/2020	-	-	-	None	-	-	-
2010-4	Home Ec Room C-22 Station 4	SK	Арр	19.1	6/25/2020				Additional Sampling Required			
2011-1	Hall by Room C-21	WF	Арр		6/25/2020	-	-	-	Non-functional Sampliing Required	-	-	-
2012-1	Copy Room M-29 Bathroom	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2013-1	Girls Bathroom by Room M-26 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2013-2	Girls Bathroom by Room M-26 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2014-1	Boys Bathroom by Room M-26 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2014-2	Boys Bathroom by Room M-26 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2014-3	Boys Bathroom by Room M-26 @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2015-1	Science Room M-23 Counter @ A	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2015-2	Science Room M-23 Counter @ B	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2015-3	Science Room M-23 Counter @ C	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2015-4	Science Room M-23 Counter @ D	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2015-5	Science Room M-23 Counter @ E	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-

Hauppauge Middle School

Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2016-1	Science Prep Room between M-23 & M-21	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2017-1	Science Room M-21 Counter @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2017-2	Science Room M-21 Counter @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2017-3	Science Room M-21 Counter @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2017-4	Science Room M-21 Counter @ D	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2017-5	Science Room M-21 Counter @ E	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2018-1	Hall by Science Room M-23	WF	Арр	<1.0	6/25/2020	-	-	-	None	-	-	-
2019-1	Boys Bathroom by Room A-27 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2019-2	Boys Bathroom by Room A-27 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2020-1	Custodial Closet by Room A-27	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2021-1	Girls Bathroom by Room A-24 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2021-2	Girls Bathroom by Room A-24 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2022-1	Science Room A-213	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2023-1	Science Room A-214 Teachers Station	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2023-2	Science Room A-214 Counter @ A	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2023-3	Science Room A-214 Counter @ B	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2023-4	Science Room A-214 Counter @ C	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2024-1	Science Room A-215 Teachers Station	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2024-2	Science Room A-215 Counter @ A	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2024-3	Science Room A-215 Counter @ B	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-



Space #	Sample Location	Fixture Type	App or N/A	Latest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Date	Remedial Recommendation	Remedial Response	Post Remedial Results (ppb)	Post Remedial Sampling Date
2024-4	Science Room A-215 Counter @ C	SK	N/A		6/25/2020	-	-	-	None	SIGN	-	-
2025-1	Custodial Closet by Science Room A-115	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2026-1	Custodial Closet by Room S-22	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2027-1	Science Room S-22 Counter @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2027-2	Science Room S-22 Counter @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2027-3	Science Room S-22 Counter @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2028-1	Science Prep Room between S-22 & S-23	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2029-1	Home Ec Room S-23	SK	Арр	1.98	6/25/2020	-	-	-	None	-	-	-
2030-1	Womens Bathroom by Room B-23 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2030-2	Womens Bathroom by Room B-23 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2030-3	Womens Bathroom by Room B-23 @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2031-1	Mens Bathroom by Room B-23 @ A	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2031-2	Mens Bathroom by Room B-23 @ B	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2031-3	Mens Bathroom by Room B-23 @ C	SK	N/A		6/25/2020	-	-	-	Sign Required	-	-	-
2032-1	Custodial Closet by Room B-20A	SS	N/A		6/25/2020	-	-	-	Sign Required	-	-	-



Laboratory Report

NYE Report #: 2202296-14730

June 29, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Hauppauge Middle School, Hauppauge, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on June 26, 2020. New York Environmental analyzed the samples on June 26, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	25 Jun 2020
Date Received:	26 Jun 2020
Date Analyzed:	26 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200626J041	1	Kitchen 2 Bay-SK; Initial	1.00	<1.00	μg/L	
200626J042	2	Kitchen 3 Bay @ A (Left)-SK; Initial	1.00	1.45	μg/L	
200626J043	3	Kitchen 3 Bay @ B (Right)-SK; Initial	1.00	<1.00	μg/L	
200626J044	4	Kitchen Pot Filler @ A (Left)-SP; Initial	1.00	109	μg/L	E,H
200626J045	5	Kitchen Pot Filler @ B (Right)-SP; Initial	1.00	3.12	μg/L	
200626J046	6	Serving Line 1 Bay @ A (Left)-SK; Initial	1.00	<1.00	μg/L	
200626J047	7	Serving Line 1 Bay @ B (Right)-SK; Initial	1.00	<1.00	μg/L	
200626J048	8	Café @ A (Left)-WF; Initial	1.00	<1.00	μg/L	
200626J049	9	Café @ B (Right)-WF; Initial	1.00	<1.00	μg/L	
200626J050	10	Faculty Café -SK; Initial	1.00	2.66	μg/L	
200626J051	11	Café Snack Room-SK; Initial	1.00	3.75	μg/L	
200626J052	12	Hall by Café-WF; Initial	1.00	<1.00	μg/L	
200626J053	13	Hall by Café-BF; Initial	1.00	<1.00	μg/L	
200626J054	14	Auxilary Gym-WF; Initial	1.00	15.9	μg/L	Н
200626J055	15	Hall by Auxilary Gym-WF; Initial	1.00	<1.00	μg/L	
200626J056	16	Hall by Auxilary Gym-BF; Initial	1.00	<1.00	μg/L	
200626J057	17	Girls Locker Room @ A (Left)-WF; Initial	1.00	<1.00	μg/L	
200626J058	18	Girls Locker Room @ B (Right)-WF; Initial	1.00	<1.00	μg/L	
200626J059	19	Boys Locker Room @ A (Left)-WF; Initial	1.00	<1.00	μg/L	
200626J060	20	Boys Locker Room @ B (Right)-WF; Initial	1.00	<1.00	μg/L	
200626J061	21	Band/Orchestra Room C-102-WF; Initial	1.00	1.02	μg/L	
200626J062	22	Vocal Room C-106-WF; Initial	1.00	<1.00	μg/L	
200626J063	23	Tech Room M-11 @ A (Left)-SK; Initial	1.00	6.50	μg/L	
200626J064	24	Tech Room M-11 @ B (Middle)-SK; Initial	1.00	11.7	μg/L	
200626J065	25	Tech Room M-11 @ C (Right)-SK; Initial	1.00	82.4	μg/L	E,H
200626J066	26	Nurses Office by Bathroom-SK; Initial	1.00	1.14	μg/L	



Date Collected:	25 Jun 2020
Date Received:	26 Jun 2020
Date Analyzed:	26 Jun 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200626J067	27	Nurses Office by Main Desk-SK; Initial	1.00	33.7	μg/L	Н
200626J068	28	Hall by Nurses Office-WF; Initial	1.00	<1.00	μg/L	
200626J069	29	Hall by Nurses Office-BF; Initial	1.00	<1.00	μg/L	
200626J070	30	Hall by Room A-13-WF; Initial	1.00	<1.00	μg/L	
200626J071	31	Hall by Library-WF; Initial	1.00	<1.00	μg/L	
200626J072	32	Hall by Library-BF; Initial	1.00	<1.00	μg/L	
200626J073	33	Library Break Room-SK; Initial	1.00	20.9	μg/L	Н
200626J074	34	Home Ec Room C-23 Station 1-SK; Initial	1.00	9.35	μg/L	
200626J075	35	Home Ec Room C-23 Station 2-SK; Initial	1.00	15.2	μg/L	Н
200626J076	36	Home Ec Room C-23 Station 3-SK; Initial	1.00	20.7	μg/L	Н
200626J077	37	Home Ec Room C-23 Station 4-SK; Initial	1.00	64.4	μg/L	E,H
200626J078	38	Home Ec Room C-22 Station 1-SK; Initial	1.00	16.2	μg/L	Н
200626J079	39	Home Ec Room C-22 Station 2-SK; Initial	1.00	5.28	μg/L	
200626J080	40	Home Ec Room C-22 Station 3-SK; Initial	1.00	2.53	μg/L	
200626J081	41	Home Ec Room C-22 Station 4-SK; Initial	1.00	19.1	μg/L	Н
200626J082	42	Hall by Science Room M-23-WF; Initial	1.00	<1.00	μg/L	
200626J083	43	Home Ec Room S-23-SK; Initial	1.00	1.98	μg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.



Appendix F



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
1001-1	Kitchen Handwash @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1001-2	Kitchen Prep 1 Bay	SK	Арр	11.4	6/30/2020	-	-	-	None	-
1001-3	Kitchen Dishwashing Station	SPRAY	Арр	2.04	6/30/2020	-	-	-	None	-
1001-4	Kitchen Pot Filler @ A	SP	Арр	10.6	6/30/2020	-	-	-	None	-
1001-5	Kitchen Pot Filler @ B	SP	Арр	6.76	6/30/2020	-	-	-	None	-
1001-6	Kitchen Handwash @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1001-7	Kitchen Prep 2 Bay	SK	Арр	4.15	6/30/2020	-	-	-	None	-
1001-8	Kitchen Locker Room Staff Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1001-9	Kitchen Storage Custodial Closet	SS	N/A		6/30/2020	-	-	-	Sign Required	-
1002-1	Wood Shop Room 131 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1002-2	Wood Shop Room 131 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1003-1	Room 130	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1004-1	Custodial Office Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1004-2	Custodial Office Custodial Closet	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1005-1	Room 136 Photo Washing Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1005-2	Room 136 Tool Washing Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1006-1	Room 135 Handwash	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	e High School Sample Location	Fixture Type	App or	Lastest 1 st Draw Results	Latest 1st Draw Sampling	15 Second Draw Results	60 Second Draw Results	Flush Sampling	Remedial Recommendation	Remedial Response
		Туре	N/A	(ppb)	Date	(ppb)	(ppb)	Date	Recommendation	Response
1007-1	Room 137 Auto Shop	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1008-1	Room 138	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1009-1	Teachers Faculty Room 141	WF	Арр	2.7	6/30/2020	-	-	-	None	-
1009-2	Teachers Faculty Room 141	SK	Арр	3.85	6/30/2020	-	-	-	None	-
1009-3	Teachers Faculty Room 141 Mens Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1009-4	Teachers Faculty Room 141 Womens Bathroom @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1009-5	Teachers Faculty Room 141 Womens Bathroom @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1010-1	Mens Faculty Bathroom by Room 142 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1010-2	Mens Faculty Bathroom by Room 142 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1010-3	Mens Faculty Bathroom by Room 142 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1011-1	Hall by Room 142	WF	Арр	<1.0	6/30/2020	-	-	-	None	-
1011-2	Hall by Room 142	BF	Арр	<1.0	6/30/2020	-	-	-	None	-
1012-1	Womens Faculty Bathroom by Room 142 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1012-2	Womens Faculty Bathroom by Room 142 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1012-3	Womens Faculty Bathroom by Room 142 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1012-4	Womens Faculty Bathroom by Room 142 @ D	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1013-1	Photo Copy Room 144A	SK	Арр	20	6/30/2020				Additional Sampling Required	



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
1014-1	Eagles Nest Kitchen by Security 2 Bay	SK	Арр	34.1	6/30/2020				Additional Sampling Required	
1015-1	Custodial Closet by Eagles Nest	SS	N/A		6/30/2020	-	-	-	Sign Required	-
1016-1	Grounds & Security Office	WF	Арр	2.46	6/30/2020	-	-	-	None	-
1016-2	Grounds & Security Office Mens Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1016-3	Grounds & Security Office Womens Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1016-4	Grounds & Security Office Kitchenette	SK	Арр	2.33	6/30/2020	-	-	-	None	-
1016-5	Grounds & Security Office Kitchenette	SPRAY	N/A		6/30/2020	-	-	-	Sign Required	-
1017-1	Girls Bathroom by Room 152 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1017-2	Girls Bathroom by Room 152 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1017-3	Girls Bathroom by Room 152 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1018-1	Hall by Room 152	WF	Арр	1.7	6/30/2020	-	-	-	None	-
1019-1	Hall by Room 152	WF	Арр	1.7	6/30/2020				None	
1019-2	Hall by Room 152	WF	Арр	1.7	6/30/2020				None	
1019-3	Hall by Room 152	WF	Арр	1.7	6/30/2020				None	
1020-1	Custodial Closet by Room 152	WF	Арр	1.7	6/30/2020				None	
1021-1	Weight Room 190	WF	Арр	<1.0	6/30/2020	-	-	-	None	-
1021-2	Weight Room 190	BF	Арр	<1.0	6/30/2020	-	-	-	None	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
1022-1	Hall by Room 193	WF	Арр	<1.0	6/30/2020	-	-	-	None	-
1022-2	Hall by Room 193	BF	Арр	<1.0	6/30/2020	-	-	-	None	-
1023-1	Mens Bathroom by Wrestling Room 191 @ /	A SK	N/A		6/30/2020	-	-	-	Sign Required	-
1023-2	Mens Bathroom by Wrestling Room 191 @ B	3 SK	N/A		6/30/2020	-	-	-	Sign Required	-
1024-1	Womens Bathroom by Wrestling Room 191 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1024-2	Womens Bathroom by Wrestling Room 191 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-1	Girls Locker Room Halsey Taylor Model	WF	Арр	4.35	6/30/2020	-	-	-	None	-
1025-2	Girls Locker Room @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-3	Girls Locker Room @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-4	Girls Locker Room @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-5	Girls Locker Room @ D	WF	N/A		6/30/2020	-	-	-	Sign Required	-
1025-6	Girls Locker Room @ E	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-7	Girls Locker Room @ F	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-8	Girls Locker Room @ G	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-9	Girls Locker Room @ H	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-10	Girls Locker Room Elkay Model	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-11	Girls Locker Room Elkay Model	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	e High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
1025-12	Girls Locker Room Track Cage Bathroom @ .	A SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-13	Girls Locker Room Track Cage Bathroom @	3 SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-14	Girls Locker Room Coaches Office Bathroon @ A	WF	N/A		6/30/2020	-	-	-	Sign Required	-
1025-15	Girls Locker Room Coaches Office Bathroon @ B	BF	N/A		6/30/2020	-	-	-	Sign Required	-
1025-16	Girls Locker Room Lacrosse Cage Bathroom @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-17	Girls Locker Room Lacrosse Cage Bathroom @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1025-18	Girls Locker Room Custodial Closet	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-1	Boys Locker Room New Elkay Model	WF	Арр	<1.0	6/30/2020	-	-	-	None	-
1026-2	Boys Locker Room New Elkay Model	BF	Арр	<1.0	6/30/2020	-	-	-	None	-
1026-3	Boys Locker Room Old Elkay Model	WF	N/A		6/30/2020	-	-	-	Sign Required	-
1026-4	Boys Locker Room (Left) @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-5	Boys Locker Room (Left) @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-6	Boys Locker Room (Left) @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-7	Boys Locker Room (Right) @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-8	Boys Locker Room (Right) @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-9	Boys Locker Room (Right) @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-10	Boys Locker Room Custodial Closet	SS	N/A		6/30/2020	-	-	-	Sign Required	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
1026-11	Boys Locker Room Track Cage Bathroom @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-12	Boys Locker Room Track Cage Bathroom @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-13	Boys Locker Room Coach's Office @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-14	Boys Locker Room Coach's Office @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-15	Boys Locker Room Wrestling Cage Bathoon @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-16	Boys Locker Room Wrestling Cage Bathoon @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1026-17	Boys Locker Room JV Wrestling Cage Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1027-1	Team Room 167	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1028-1	Team Room 168	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1029-1	Laundry Room	SK	Арр	14.7	6/30/2020	-	-	-	None	-
1029-2	Laundry Room	SK	Арр	<1.0	6/30/2020	-	-	-	None	-
1030-1	Main Pool Area	SK	Арр	<1.0	6/30/2020	-	-	-	None	-
1030-2	Main Pool Area Custodial Closet	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1031-1	Boys Pool Locker Room @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1031-2	Boys Pool Locker Room @ B	IM	N/A		6/30/2020	-	-	-	Sign Required	-
1031-3	Boys Pool Locker Room @ C	WF	N/A		6/30/2020	-	-	-	Sign Required	-
1031-4	Boys Pool Locker Room Bathroom by Entrance	SS	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	e High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
1031-5	Boys Pool Locker Room Bathroom by Pool	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1031-6	Boys Pool Locker Room Custodial Closet	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1032-1	Girls Pool Locker Room @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1032-2	Girls Pool Locker Room @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1032-3	Girls Pool Locker Room @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1032-4	Girls Pool Locker Room Bathroom by Pool	SS	N/A		6/30/2020	-	-	-	Sign Required	-
1032-5	Girls Pool Locker Room Bathroom by Entrance	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1032-6	Girls Pool Locker Room Custodial Closet	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1033-1	Pool Hallway Girls Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1033-2	Pool Hallway Boys Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2001-1	Main Office	WF	Арр	1.26	6/30/2020	-	-	-	None	-
2001-2	Main Office Staff Bathroom (Old Womens)	SS	N/A		6/30/2020	-	-	-	Sign Required	-
2001-3	Main Office Nurses Student Bathroom (Old Mens)	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2001-4	Main Office Assistant Principal Bathroom by 250L	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2001-5	Main Office Nurses Office	WF	Арр	40.7	6/30/2020				Additional Sampling Required	
2001-6	Main Office Nurses Office Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2002-1	Boys Bathroom by Room 207 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
2002-2	Boys Bathroom by Room 207 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2002-3	Boys Bathroom by Room 207 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2003-1	Hall by Room 207	WF	Арр	1.22	6/30/2020	-	-	-	None	-
2003-2	Hall by Room 207	BF	Арр	<1.0	6/30/2020	-	-	-	None	-
2004-1	Girls Bathroom by Room 207 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2004-2	Girls Bathroom by Room 207 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2004-3	Girls Bathroom by Room 207 @ C	WF	N/A		6/30/2020	-	-	-	Sign Required	-
2005-1	Mens Bathroom by Room 207	BF	N/A		6/30/2020	-	-	-	Sign Required	-
2006-1	Custodial Closet by Room 209	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2007-1	Womens Bathroom by Room 209	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2008-1	Room 206A	SK	Арр	5.15	6/30/2020	-	-	-	None	-
2009-1	Girls Bathroom by Room 242 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2009-2	Girls Bathroom by Room 242 @ B	SS	N/A		6/30/2020	-	-	-	Sign Required	-
2009-3	Girls Bathroom by Room 242 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2009-4	Girls Bathroom by Room 242 @ D	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2010-1	Hall by Room 242	WF	Арр	<1.0	6/30/2020	-	-	-	None	-
2011-1	Boys Bathroom by Room 242 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	e High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
2011-2	Boys Bathroom by Room 242 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2011-3	Boys Bathroom by Room 242 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2012-1	Womens Bathroom by Room 241	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2013-1	Custodial Closet by Room 241	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2014-1	Mens Bathroom by Room 241	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2015-1	Prep Room between Room 241 & 243	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2016-1	Home Economics Room 232A	SK	Арр	18	6/30/2020				Additional Sampling Required	
2017-1	Home Economics Room 232	SS	Арр	30.1	6/30/2020				Additional Sampling Required	
2018-1	Room 233	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2018-2	Room 233 Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2019-1	Room 237	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2019-2	Room 237 2 Bay @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2019-3	Room 237 2 Bay @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2019-4	Room 237 2 Bay @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2019-5	Room 237 2 Bay @ D	SS	N/A		6/30/2020	-	-	-	Sign Required	-
2019-6	Room 237 2 Bay @ E	SP	N/A		6/30/2020	-	-	-	Sign Required	-
2019-7	Room 237 2 Bay @ F	SP	N/A		6/30/2020	-	-	-	Sign Required	-

Space #	ge High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
2020-1	Room 238 @ A	SP	N/A		6/30/2020	-	-	-	Sign Required	-
2020-2	Room 238 @ B	SP	N/A		6/30/2020	-	-	-	Sign Required	-
2021-1	Room 234 Unit 1 @ A	SP	N/A		6/30/2020	-	-	-	Sign Required	-
2021-2	Room 234 Unit 1 @ B	SP	N/A		6/30/2020	-	-	-	Sign Required	-
2021-3	Room 234 Unit 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2021-4	Room 234 Unit 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2021-5	Room 234 Unit 2 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2022-1	Room 239 Unit 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2022-2	Room 239 Unit 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2023-1	Girls Bathroom by Room 261 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2023-2	Girls Bathroom by Room 261 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2023-3	Girls Bathroom by Room 261 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2024-1	Boys Bathroom by Room 261 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2024-2	Boys Bathroom by Room 261 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2024-3	Boys Bathroom by Room 261 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2025-1	Mens Bathroom by Gym @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
2025-2	Mens Bathroom by Gym @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Lastest Latest 15 Second 60 Second Flush App Fixture 1st Draw Draw Draw Remedial Remedial 1st Draw Space # **Sample Location** Sampling or Recommendation Type Sampling Results Results Results Response N/A Date Date (ppb) (ppb) (ppb) Custodial Closet by Gym Sign Required 2026-1 SK N/A 6/30/2020 2027-1 SK N/A 6/30/2020 Sign Required Womens Bathroom by Gym @ A 2027-2 Womens Bathroom by Gym @ B SK N/A 6/30/2020 Sign Required 2028-1 Hall by Gym SK App <1.0 6/30/2020 None 2028-2 Hall by Gym SS 6/30/2020 App <1.0 None Athletic Trainers Office Bathroom 2029-1 SK N/A 6/30/2020 Sign Required 2030-1 Hall by Athletic Trainers Office WF 6/30/2020 App <1.0 None 2030-2 Hall by Athletic Trainers Office BF <1.0 6/30/2020 App None Non-functional WF 2031-1 Hall by Concession Stand App 6/30/2020 Sampling Required 2032-1 Coaches Office Bathroom SK N/A 6/30/2020 Sign Required **Additional Sampling** 2033-1 **Concession Stand** SK 99.2 6/30/2020 App Required 2033-2 Concession Stand IM App <1.0 6/30/2020 None 2034-1 Womens Dressing Room Bathroom SK N/A 6/30/2020 Sign Required Non-functional Hall by Womens Dressing Room 2035-1 WF 6/30/2020 App Sampling Required Mens Dressing Room Bathroom SK 2036-1 N/A 6/30/2020 Sign Required Custodial Closet by Auditorium 2037-1 IM N/A 6/30/2020 Sign Required Custodial Closet by Gym 2038-1 SS N/A 6/30/2020 Sign Required



Space #	e High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3001-1	Library Office	SK	Арр	23	6/30/2020				Additional Sampling Required	
3001-2	Library Office Bathroom	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3002-1	Hall by Room 307	WF	Арр	<1.0	6/30/2020	-	-	-	None	SIGN
3002-2	Hall by Room 307	BF	Арр	<1.0	6/30/2020	-	-	-	None	-
3003-1	Boys Bathroom by Room 307 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3003-2	Boys Bathroom by Room 307 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3003-3	Boys Bathroom by Room 307 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3004-1	Girls Bathroom by Room 307 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3004-2	Girls Bathroom by Room 307 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3004-3	Girls Bathroom by Room 307 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3005-1	Mens Bathroom by Room 307	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3006-1	Custodial Closet by Room 307	SS	N/A		6/30/2020	-	-	-	Sign Required	-
3007-1	Womens Bathroom by Room 307	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3008-1	Science Room 346	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3009-1	Prep Room 344A	SK	Арр	13.9	6/30/2020	-	-	-	None	SIGN
3010-1	Science Room 344 Counter @ A	SS	N/A		6/30/2020	-	-	-	Sign Required	-
3010-2	Science Room 344 Counter @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3011-1	Science Room 345 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3011-2	Science Room 345 Counter 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3011-3	Science Room 345 Counter 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3011-4	Science Room 345 Counter 2	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3011-5	Science Room 345 Prep Room	SK	Арр	26.8	6/30/2020				Additional Sampling Required	
3012-1	Hall by Room 345	WF	Арр	<1.0	6/30/2020	-	-	-	None	-
3012-2	Hall by Room 345	BF	Арр	<1.0	6/30/2020	-	-	-	None	-
3013-1	Girls Bathroom by Science Room 345 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3013-2	Girls Bathroom by Science Room 345 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3013-3	Girls Bathroom by Science Room 345 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3013-4	Girls Bathroom by Science Room 345 @ D	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3014-1	Boys Bathroom by Science Room 345 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3014-2	Boys Bathroom by Science Room 345 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3014-3	Boys Bathroom by Science Room 345 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3015-1	Prep Room 342A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3016-1	Science Room 341 Counter	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3016-2	Science Room 341 POD 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	e High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3016-3	Science Room 341 POD 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3016-4	Science Room 341 POD 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3016-5	Science Room 341 POD 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3016-6	Science Room 341 Prep Room	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3017-1	Science Room 340 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3017-2	Science Room 340 Counter @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3017-3	Science Room 340 Counter @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3018-1	Womens Bathroom by Room 334	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3019-1	Custodial Closet by Room 334	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3020-1	Mens Bathroom by Room 334	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-1	Science Room 335 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-2	Science Room 335 Table 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-3	Science Room 335 Table 1 @ B	SS	N/A		6/30/2020	-	-	-	Sign Required	-
3021-4	Science Room 335 Table 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-5	Science Room 335 Table 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-6	Science Room 335 Table 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-7	Science Room 335 Table 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3021-8	Science Room 335 Table 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-9	Science Room 335 Table 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-10	Science Room 335 Table 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-11	Science Room 335 Table 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-12	Science Room 335 Table 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-13	Science Room 335 Table 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3021-14	Science Room 335 Table 7	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3022-1	Prep Room between Rooms 335 & 333	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3023-1	Science Room 332 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3023-2	Science Room 332 Counter @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3023-3	Science Room 332 Counter @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3023-4	Prep Room 332	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3024-1	Science Room 333 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3024-2	Science Room 333 Counter 1	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3024-3	Science Room 333 Counter 2	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3025-1	Prep Room between Rooms 331 & 333	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3026-1	Prep Room 330A	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3027-1	Science Room 331 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-2	Science Room 331 Table 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-3	Science Room 331 Table 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-4	Science Room 331 Table 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-5	Science Room 331 Table 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-6	Science Room 331 Table 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1004-3	Science Room 331 Table 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-8	Science Room 331 Table 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-9	Science Room 331 Table 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-10	Science Room 331 Table 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-11	Science Room 331 Table 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-12	Science Room 331 Table 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-13	Science Room 331 Table 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3027-14	Science Room 331 Table 7	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-1	Science Room 330 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-2	Science Room 330 POD 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-3	Science Room 330 POD 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	e High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3028-4	Science Room 330 POD 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-5	Science Room 330 POD 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-6	Science Room 330 POD 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-7	Science Room 330 POD 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-8	Science Room 330 POD 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-9	Science Room 330 POD 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1004-3	Science Room 330 POD 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-11	Science Room 330 POD 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-12	Science Room 330 POD 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-13	Science Room 330 POD 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-14	Science Room 330 Counter @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-15	Science Room 330 Counter @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3028-16	Science Room 330 Counter @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-1	Science Room 337 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-2	Science Room 337 Table 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-3	Science Room 337 Table 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-4	Science Room 337 Table 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-

	-	
Hauppa	uge Hig	jh Schoo

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3029-5	Science Room 337 Table 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-6	Science Room 337 Table 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-7	Science Room 337 Table 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-8	Science Room 337 Table 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-9	Science Room 337 Table 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-10	Science Room 337 Table 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-11	Science Room 337 Table 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-12	Science Room 337 Table 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-13	Science Room 337 Table 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3029-14	Science Room 337 Counter	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3030-1	Prep Room 338A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-1	Science Room 338 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-2	Science Room 338 Table 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-3	Science Room 338 Table 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-4	Science Room 338 Table 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-5	Science Room 338 Table 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-6	Science Room 338 Table 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-

Space #	e High School Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3031-7	Science Room 338 Table 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-8	Science Room 338 Table 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-9	Science Room 338 Table 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-10	Science Room 338 Table 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-11	Science Room 338 Table 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-12	Science Room 338 Table 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-13	Science Room 338 Table 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3031-14	Science Room 338 Table 7	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3032-1	Prep Room 339A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-1	Science Room 339 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-2	Science Room 339 Table 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-3	Science Room 339 Table 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-4	Science Room 339 Table 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-5	Science Room 339 Table 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-6	Science Room 339 Table 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-7	Science Room 339 Table 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-8	Science Room 339 Table 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3033-9	Science Room 339 Table 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-10	Science Room 339 Table 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-11	Science Room 339 Table 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1004-3	Science Room 339 Table 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-13	Science Room 339 Table 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3033-14	Science Room 339 Table 7	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-1	Science Room 336 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-2	Science Room 336 POD 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-3	Science Room 336 POD 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-4	Science Room 336 POD 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-5	Science Room 336 POD 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-6	Science Room 336 POD 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-7	Science Room 336 POD 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-8	Science Room 336 POD 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-9	Science Room 336 POD 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-10	Science Room 336 POD 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-11	Science Room 336 POD 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3034-12	Science Room 336 POD 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-13	Science Room 336 POD 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-14	Science Room 336 Counter @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3034-15	Science Room 336 Counter @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3035-1	Prep Room 336A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-1	Science Room 334 Teachers Station	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-2	Science Room 334 POD 1 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-3	Science Room 334 POD 1 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-4	Science Room 334 POD 2 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-5	Science Room 334 POD 2 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-6	Science Room 334 POD 3 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-7	Science Room 334 POD 3 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-8	Science Room 334 POD 4 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-9	Science Room 334 POD 4 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
1004-3	Science Room 334 POD 5 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-11	Science Room 334 POD 5 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-12	Science Room 334 POD 6 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-



Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
3036-13	Science Room 334 POD 6 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-14	Science Room 334 Counter @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-15	Science Room 334 Counter @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3036-16	Science Room 334 Counter @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3037-1	Career Center Room 351 Kitchenette	SK	Арр	25.1	6/30/2020				Additional Sampling Required	
3038-1	Girls Bathroom by Room 361 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3038-2	Girls Bathroom by Room 361 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3038-3	Girls Bathroom by Room 361 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3039-1	Hall by Room 361	WF	Арр	<1.0	6/30/2020	-	-	-	None	SIGN
3039-2	Hall by Room 361	BF	Арр	<1.0	6/30/2020	-	-	-	None	-
3040-1	Boys Bathroom by Room 361 @ A	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3040-2	Boys Bathroom by Room 361 @ B	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3040-3	Boys Bathroom by Room 361 @ C	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3041-1	Womens Bathroom by Room 361	SK	N/A		6/30/2020	-	-	-	Sign Required	-
3042-1	Custodial Closet by Room 361	SS	N/A		6/30/2020	-	-	-	Sign Required	-
3043-1	Mens Bathroom by Room 361	SK	N/A		6/30/2020	-	-	-	Sign Required	-
0001-1	Pool Basement	SS	N/A		6/30/2020	-	-	-	Sign Required	-



School Water Outlet Inventory

Lead in School Drinking Water Program 2020

H	lau	p	pa	ug	e	High	1	School	
- 6									

Space #	Sample Location	Fixture Type	App or N/A	Lastest 1 st Draw Results (ppb)	Latest 1st Draw Sampling Date	15 Second Draw Results (ppb)	60 Second Draw Results (ppb)	Flush Sampling Date	Remedial Recommendation	Remedial Response
0002-1	Boiler Room	SS	N/A		6/30/2020	-	-	-	Sign Required	-



Laboratory Report

NYE Report #: 2202420-14802

July 6, 2020

Enviroscience Consultants, Inc. 2150 Smithtown Avenue Ronkonkoma, NY 11779

Project: Hauppauge High School Hauppauge, NY

Dear Project Manager,

Enclosed is the Laboratory Analytical Report for potable water sample(s) received on July 02, 2020. New York Environmental analyzed the samples on July 03, 2020 for Lead (Pb) by EPA Method 200.9 Rev. 2.2.

If there are any questions regarding the analyses, please feel free to contact us at your convenience. New York Environmental is a NELAP accredited laboratory. Attached reported results meet the requirements of the NELAP standards unless otherwise noted.

Samples' analytical results relate only to the samples tested, in the condition received by the laboratory. This report shall not be reproduced except in its entirety without written approval of the laboratory.

We sincerely thank you for your business, and look forward to being of service for your future environmental testing needs.

Sincerely,

Li Tsang, Laboratory Director

Date Collected:	30 Jun 2020
Date Received:	02 Jul 2020
Date Analyzed:	03 Jul 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
2007020082	1	Kitchen Prep 1 Bay-SK; Initial	1.00	11.4	μg/L	
200702O083	2	Kitchen Dishwashing Station-SPRAY; Initial	1.00	2.04	μg/L	
2007020084	3	Kitchen Pot Filler @ A-SP; Initial	1.00	10.6	μg/L	
200702O085	4	Kitchen Pot Filler @ B-SP; Initial	1.00	6.76	μg/L	
200702O086	5	Kitchen Prep 2 Bay-SK; Initial	1.00	4.15	μg/L	
200702O087	6	Teachers Faculty Room 141-WF; Initial	1.00	2.70	μg/L	
200702O088	7	Teachers Faculty Room 141-SK; Initial	1.00	3.85	μg/L	
200702O089	8	Hall by Room 142-WF; Initial	1.00	<1.00	μg/L	
200702O090	9	Hall by Room 142-BF; Initial	1.00	<1.00	μg/L	
200702O091	10	Photo Copy Room 144A-SK; Initial	1.00	20.0	μg/L	Н
200702O092	11	Grounds & Security Office-WF; Initial	1.00	2.46	μg/L	
200702O093	12	Grounds & Security Office Kitchenette-SK; Initial	1.00	2.33	μg/L	
200702O094	13	Hall by Room 152-SK; Initial	1.00	1.70	μg/L	
200702O095	14	Weight Room 190-WF; Initial	1.00	<1.00	μg/L	
200702O096	15	Weight Room 190-BF; Initial	1.00	<1.00	μg/L	
200702O097	16	Hall by Room 193-WF; Initial	1.00	<1.00	μg/L	
200702O098	17	Hall by Room 193-BF; Initial	1.00	<1.00	μg/L	
200702O099	18	Girls Locker Room Halsey Taylor Model-WF; Initial	1.00	4.35	μg/L	
200702O100	19	Boys Locker Room New Elkay Model-WF; Initial	1.00	<1.00	μg/L	
200702O101	20	Boys Locker Room New Elkay Model-BF; Initial	1.00	<1.00	μg/L	
200702O102	21	Laundry Room -SK; Initial	1.00	14.7	μg/L	
200702O103	22	Laundry Room -IM; Initial	1.00	<1.00	μg/L	
200702O104	23	Main Pool Area-WF; Initial	1.00	<1.00	μg/L	
200702O105	24	Eagles Nest Kitchen by Security 2 Bay-SK; Initial	1.00	34.1	μg/L	Н
200702O106	25	Main Office-WF; Initial	1.00	1.26	μg/L	
200702O107	26	Main Office Nurses Office -SK; Initial	1.00	40.7	μg/L	Н



Date Collected:	30 Jun 2020
Date Received:	02 Jul 2020
Date Analyzed:	03 Jul 2020

Analytical Method:	EPA 200.9 Rev. 2.2
Analyte, Matrix:	Lead, Potable Water

Lab ID	CID	Sample Location/Description	LOQ	Result	Units	Flag
200702O108	27	Hall by Room 207-WF; Initial	1.00	1.22	μg/L	
200702O109	28	Hall by Room 207-BF; Initial	1.00	<1.00	μg/L	
200702O110	29	Hall by Room 242-WF; Initial	1.00	<1.00	μg/L	
200702O111	30	Room 206A-SK; Initial	1.00	5.15	μg/L	
200702O112	31	Home Economics Room 232A-SK; Initial	1.00	18.0	μg/L	Н
200702O113	32	Home Economics Room 232-SK; Initial	1.00	30.1	μg/L	Н
200702O114	33	Hall by Gym-WF; Initial	1.00	<1.00	μg/L	
200702O115	34	Hall by Gym-BF; Initial	1.00	<1.00	μg/L	
200702O116	35	Hall by Athletic Trainers Office-WF; Initial	1.00	<1.00	μg/L	
200702O117	36	Hall by Athletic Trainers Office-BF; Initial	1.00	<1.00	μg/L	
200702O118	37	Concession Stand-SK; Initial	1.00	99.2	μg/L	E,H
200702O119	38	Concession Stand-IM; Initial	1.00	<1.00	μg/L	
200702O120	39	Library Office-SK; Initial	1.00	23.0	μg/L	Н
200702O121	40	Hall by Room 307-WF; Initial	1.00	<1.00	μg/L	
200702O122	41	Hall by Room 307-BF; Initial	1.00	<1.00	μg/L	
200702O123	42	Prep Room 344A-SK; Initial	1.00	13.9	μg/L	
200702O124	43	Science Room 345 Prep Room-SK; Initial	1.00	26.8	μg/L	Н
200702O125	44	Hall by Room 345-WF; Initial	1.00	<1.00	μg/L	
200702O126	45	Hall by Room 345-BF; Initial	1.00	<1.00	μg/L	
200702O127	46	Career Center Room 351 Kitchenette-SK; Initial	1.00	25.1	μg/L	Н
200702O128	47	Hall by Room 361-WF; Initial	1.00	<1.00	μg/L	
200702O129	48	Hall by Room 361-BF; Initial	1.00	<1.00	μg/L	

Comment:

CID: Client ID LOQ: Limit of Quantitation

E: Sample result exceeds instrument calibration, value is estimated.

H: Sample result exceeds applicable regulatory limit.

